

Brodie Plat


Construction Drainage Report

Prepared for

City of Marysville 80 Columbia Ave Marysville, WA 98270

Prepared by Ryan Ferguson, EIT

> Reviewed by Tom Abbott, PE

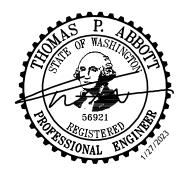

January 2023 Job No: C22-177



TABLE OF CONTENTS

Section	Title	
1	Project Overview	1-1
2	Temporary Erosion and Sediment Control Design	2-1
3	Downstream Analysis	3-1
4	Detention and Water Quality Treatment Design	4-1
5	Conveyance Analysis and Design	5-1
6	Operations and Maintenance Manual	6-1
7	Special Reports and Studies	7-1

APPENDICES

#	Title
1	Project Overview
3	Resource Review
4	Site Hydrology



SECTION 1: PROJECT OVERVIEW

The proposed Brodie Plat project is comprised of parcel numbers 30052500302300, 30052500303800, and 30052500303900, and proposes the construction of 45 single family lots with associated utilities, ROW, and open spaces on a 10.02-acre site. There are frontage improvements proposed on the site along 60^{th} St NE, and access to the site will be from 60^{th} St NE. The site is located within the SW ¼ of the SW ¼ of Section 25, Township 30 N, Range 05 E, W.M. The project address is 8719 60^{th} St NE Marysville, WA 98270. See the Vicinity Map in Appendix 1 for visual representation of the subject property.

Existing Site

The parcel 30052500303800 is currently occupied by a cellular tower in the east and a cargo shipping storage container in the center of the parcel. The shipping container on site will be removed, and the cell tower will remain in Tract 996 with access from the public ROW. The site is bordered to the west by R18 (Multi-Family Medium) zoned land, to the north by Recreation zoned land, and to the south by R6.5 (Single Family High) zoned land. The project parcels are currently zoned Recreation and a rezone to R-18 zoning is proposed for the project site. Existing ground cover is a combination of trees, grass, and gravel.

The proposed development will exist within the bounds of the Onsite Basin and the frontage along 60th St NE. In the existing condition, the site discharges to the onsite wetland and conveyances north and west offsite. See Predeveloped and Developed Hydrology Maps in Appendix 4 for a visual representation of these basins. The project site includes a stream area and wetlands areas that are along the westerly portion of the site. Buffer averaging is proposed.

Site soils are classified as about 27% Norma loam and about 73% Tokul gravelly medial loam (where about 25% is at 0 to 8 percent slopes, about 39% is at 8 to 15 percent slopes, and about 9% is at 15 to 30 percent slopes). See the Soils Map in Appendix 3 for visual layout of soil type areas of the subject property. According to the Marysville topographic map, the existing site slopes are generally sloping from northeast to southwest. Due to till soils present onsite, the Geotechnical Engineer does not recommend infiltration for LID BMPs to be used onsite.

Proposed Development

The proposed Brodie Plat project will develop associated utilities, driveways, ROW, landscaping, and open spaces. Stormwater will be mitigated via a detention and water quality treatment system and bypass basin. Onsite development will disturb 6.46 acres of area that will be collected to the detention vault for mitigation and stormwater quality treatment, while frontage improvements will impact an additional 0.56 acres within the 60th Ave dedicated ROW a portion of onsite ROW that cannot be collected to the detention vault but will be treated for stormwater quality treatment.

Proposed Drainage System

This project is subject to the requirements of the 2014 Stormwater Management Manual for Western Washington (DOE Manual). In compliance with 2014 DOE Manual, all runoff from developed/disturbed surfaces must be collected, treated, and released to natural drainage courses unless it is dispersed or infiltrated.

Proposed pollution generating impervious surfaces (PGIS) will exceed the 5,000 SF threshold and thus basic water quality treatment will be provided via a water quality treatment structure that treats stormwater runoff from roadways and driveways.

The disturbed area of the development is contained within the Onsite Basin and the Bypass Basin. The Onsite Basin consists of onsite developed roof, landscape, sidewalk, pavement and driveway. This project is required to meet flow control requirements which are achieved by a detention vault in the



northwestern portion of the site. Developed condition stormwater associated with the Onsite Basin will be collected within the detention vault and released directly into Grace Creek, which is located directly south of and parallel to Allen Creek, after treatment in the proposed Perkfilter. Developed condition stormwater associated with the Bypass Basin will be treated by a Perkfilter and dispersed. See Section 4.0 for additional discussion regarding proposed stormwater management and water quality treatment measures.

Erosion/Sedimentation Control

Erosion control measures that will be utilized during construction will include a combination of silt fence, storm drain inlet protection, interceptor swales, and sediment pond. See Section 2.0 for discussion of how SWPPP Elements are addressed.

Minimum Requirements

Per the 2014 DOE, Minimum Requirements 1-9 apply to the proposed development.

Minimum Requirement #1: Preparation of Stormwater Site Plans

A report along with the construction plans, to be submitted at a later date, satisfies the minimum requirement.

Minimum Requirement #2: Construction Stormwater Pollution Prevention

See Section 2 of this Report for the SWPPP BMP Elements, and the SWPPP (submitted as a separate document) for a complete discussion of erosion control BMP's and their use specific to the site.

Minimum Requirement #3: Source of Pollution

Permanent source control BMPs are not applicable for the subject site since the associated activities for the new residence do not fall within the types of facilities listed within Volume IV of the DOE Manual (Residential developments are not required to implement source control BMP's). BMPs for erosion and sedimentation control are specified in the Construction Plans and the SWPPP.

Minimum Requirement #4: Preservation of Natural Drainage Systems and Outfalls

Flow from the site will preserve its natural drainage pattern from the southeast to the northwest. Runoff flows towards Grace Creek and continues northwest before leaving he quarter mile buffer of analysis.

Minimum Requirement #5: On-Site Stormwater Management

The project will exceed the 10,000 SF PGHS threshold and is required to provide an Onsite Stormwater BMP. A detention vault will be installed in the northwestern end of the site and will discharge at a historic, mitigated rate that will be dispersed into native vegetation in Tract 999.

Minimum Requirement #6: Runoff Treatment

As the project will exceed the 5,000 SF threshold of PGHS, the project is required to provide "basic" water quality treatment per the 2014 DOE manual. A Perkfilter water quality treatment unit will be installed downstream of the detention vault to meet this requirement and Modular Wetland unit will be installed along the 60th St NE frontage. Runoff from public ROW facilities will not be treated by the proposed on-site Perkfilter, which will be privately owned and maintained.

Minimum Requirement #7: Flow Control

A detention vault is proposed at the northwestern end of the site to control flows and release at historic, mitigated rates. Please see Section 4.0 for additional flow control modeling and parameters for detention sizing.

Minimum Requirement #8: Wetlands Protection




Wetlands exist onsite and have been given 100' buffers. Buffer averaging is proposed. The dispersion facility discharges from the Bypass Basin and the detention vault outfall are proposed within the outer 25% of the revised buffer line. Please see sheet RD-01 of the plan set for location information. Wetland areas will not be disturbed during site construction and will be protected with silt fencing and other BMPs throughout construction.

<u>Minimum Requirement #9: Operation and Maintenance</u> See Operations and Maintenance in Section 6 of this report.



Appendix 1: Project Overview

- 1. Figure 1.0 Vicinity Map
- 2. Figure 2.0 Existing Conditions Map
- 3. Proposed Development Map

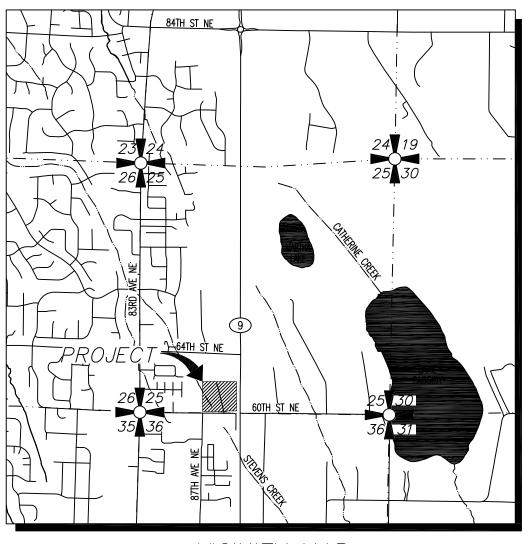

VICINITY MAP

SCALE: 1"=2000'

 $\label{lem:continuity} \begin{tabular}{lll} Drawing: P: \Civil \2022 \C22-177 Brodie Plot \Drawings \Exhibits \C22177-EX-VM.dwg & Plotted: Oct 26, 2022 - 12:12pm & Plotted: O$



Kent

T 425.806.1869

Surveying Engineering Planning

Woodinville 20210 142nd Avenue NE Woodinville, WA 98072

Olympia


 Woodinville, WA 98072

 www.LDCcorp.com
 F 425.482.2893

LAND PRO GROUP, INC.

BRODIE PLAT

VICINITY MAP

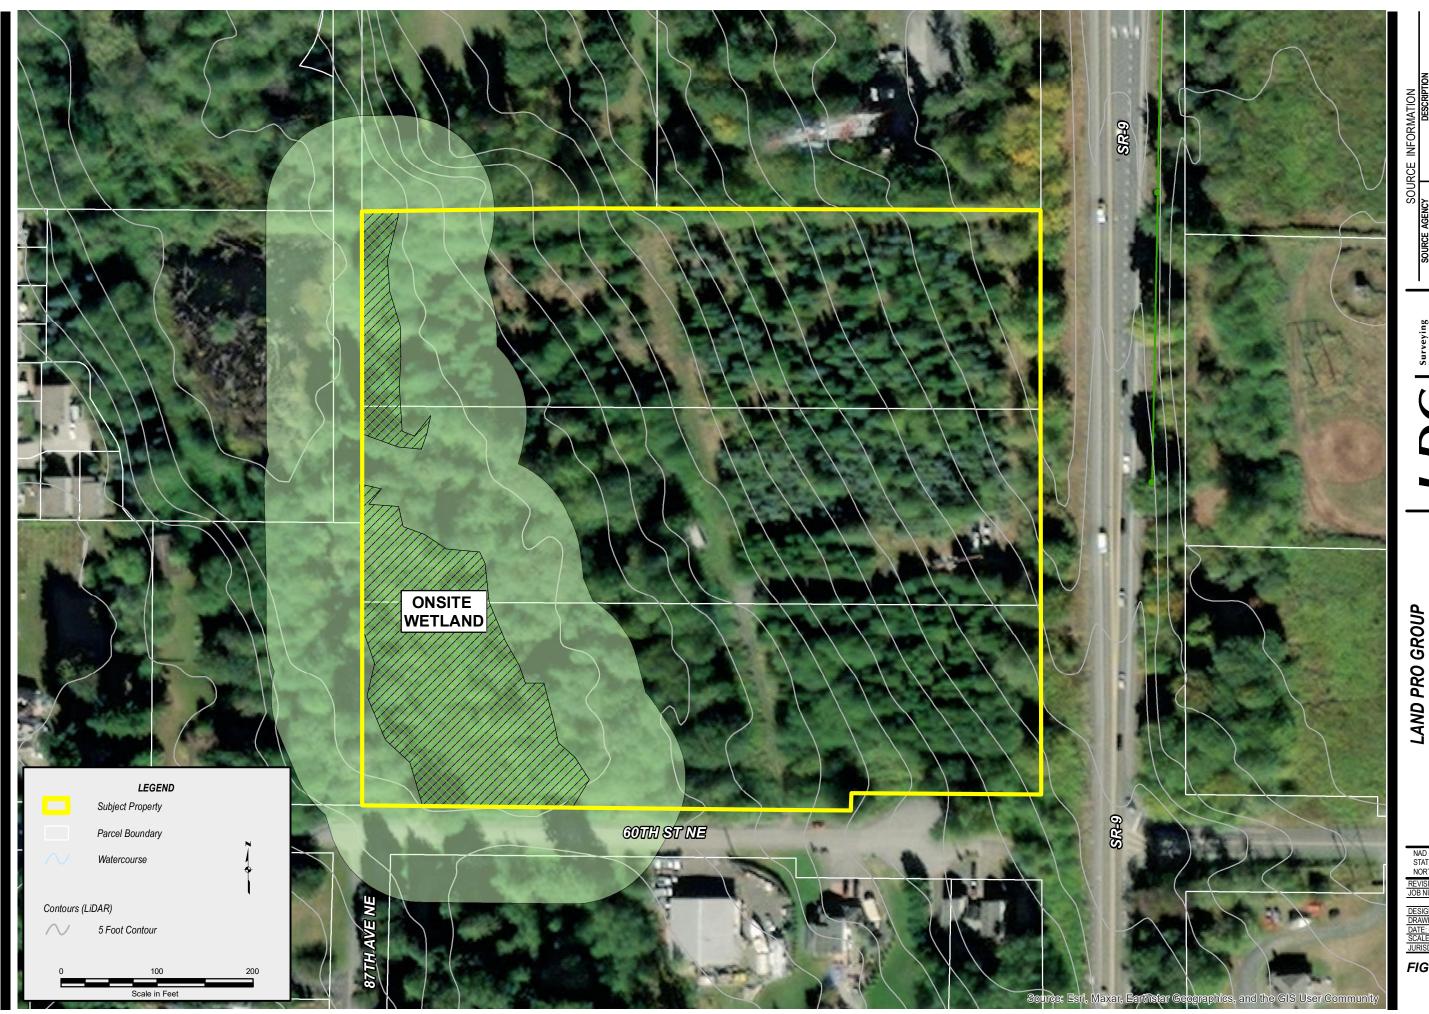

| Planning SN | Woodinville | Kent | Kent | 20210 142nd Avenue NE | 1851 Central PI 5, #101 | Woodinville, WA 98072 | Kent, WA 98030 | T 425.805.1869 | www.LDCcorp.com | F 425.4822893

BRODIE PLATEXISTING CONDITIONS MAP

NAD 1983 HARN STATEPLANE WASHINGTON NORTH FIPS 4601 FEET


EVISION: DB NUMBER: C22-177

DESIGNER: TABBOTT
DRAWING BY: TABBOTT
DATE: 6/27/2022

ATE: 6/27/2022 CALE: AS SHOWN URISDICTION: MARYSVILLE

FIGURE:

2.0

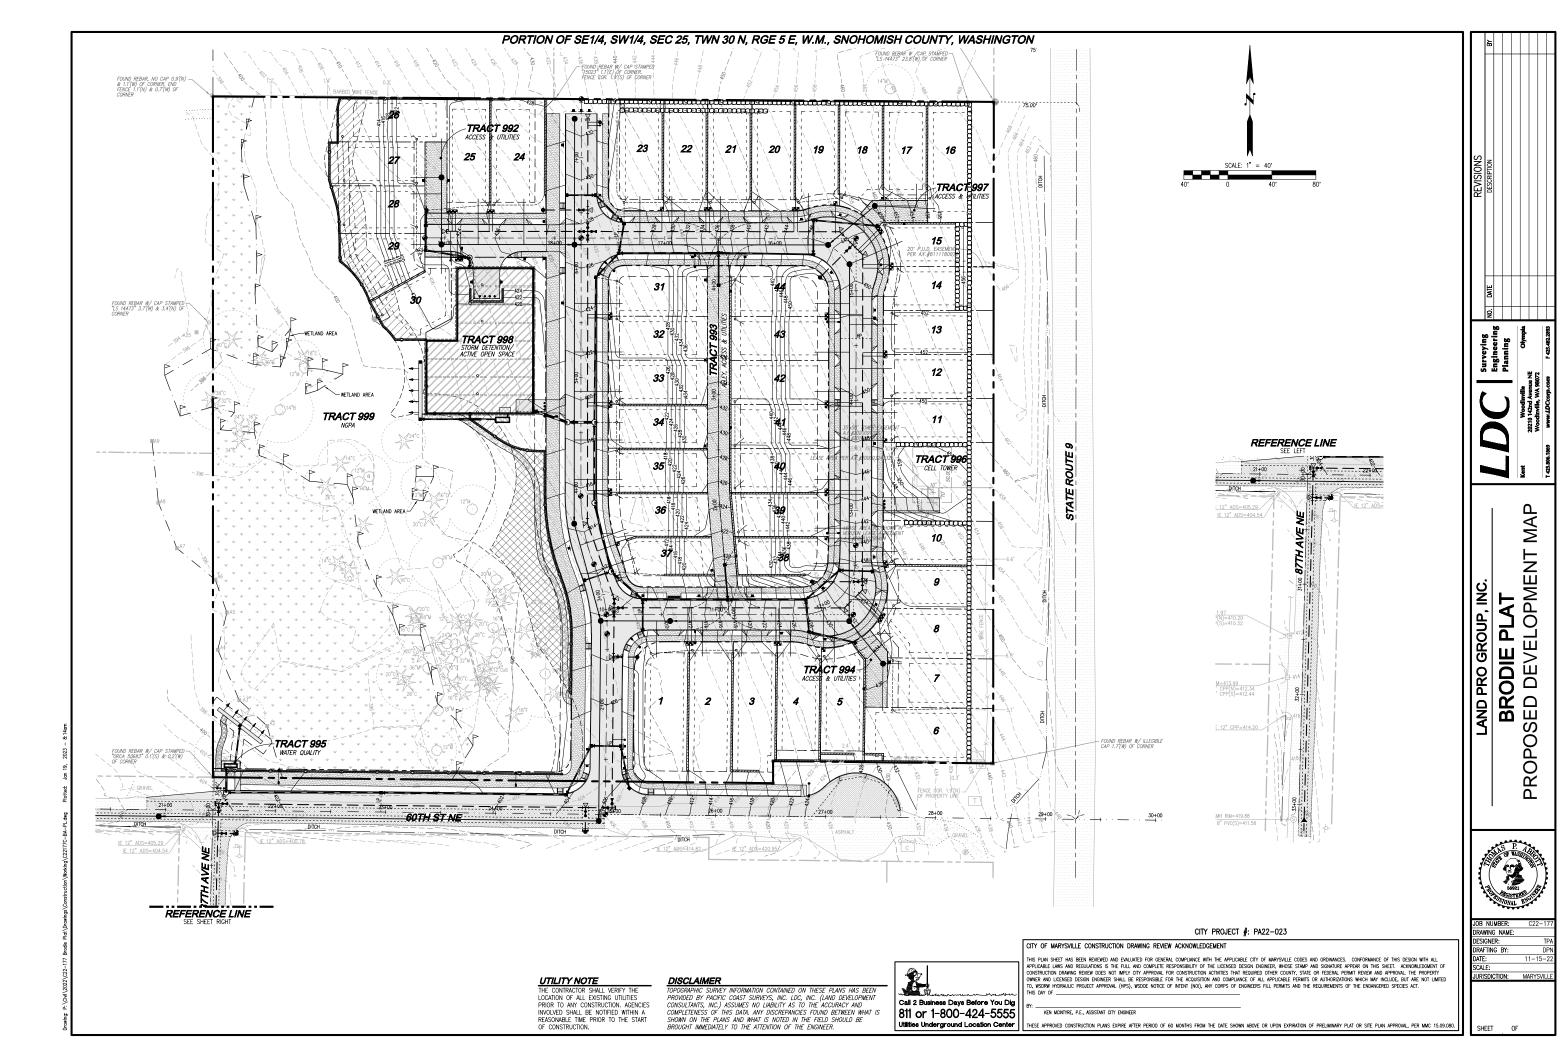



SECTION 2: TEMPORARY EROSION AND SEDIMENT CONTROL DESIGN

SWPPP Design Elements

A Stormwater Pollution Prevention Plan (SWPPP) will be provided prior to construction. The SWPPP report is modeled under the guidelines of Volume II, Section 3 of the 2014 Stormwater Management Manual for Western Washington. Construction SWPPP Elements #1 through #13 are addressed below.

Element #1 - Mark Clearing Limits

All clearing limits will be delineated with high visibility plastic fence and/or silt fence. See sheets ER-01 of the preliminary plans for locations and details.

Element #2 - Establish Construction Access

Stabilized construction accesses will be installed as shown on the preliminary plans. See sheets ER-01 and ER-02 of the construction plans for locations and details.

<u>Element #3 – Control Flow Rates</u>

Detention of construction period runoff will be provided by means of a sediment pond located at the northern portion of the site. See sheets ER-01 of the preliminary plans for location and details for flow and sediment control BMP's.

Element #4 - Install Sediment Controls

Silt fence, catch basin protection, and the temporary sediment pond will be utilized to contain sediments within the project's clearing limits. See sheets ER-01 and ER-02 of the preliminary plans for locations and details.

Element #5 - Stabilize Soils

Exposed soils will be stabilized as specified in the Grading and Erosion Control Notes with temporary and permanent seeding, mulching, and plastic covering. See sheet ER-02 of the preliminary plans for notes.

Element #6 - Protect Slopes

Slopes are minor on the subject site. Slopes shall be protected as specified under Element #5.

Element #7 - Protect Drain Inlets

Storm drain inlet protection will be utilized to contain sediments within the project's clearing limits. See sheets ER-01 and ER-02 of the preliminary plans for locations and details.

Element #8 - Stabilize Channels and Outlets

Temporary channels, shall be stabilized with check dams. See sheets ER-01 and ER-02 of the preliminary plans for locations and details.

Element #9 - Control Pollutants

Pollutants shall be controlled as specified in Volume IV of the 2014 DOE Manual—Source Control BMPs to address potential sources of pollution which may exacerbate possible soil/groundwater contamination identified onsite.

Element #10 - Control De-Watering

There will be no de-watering as a part of this project. See sheet ER-02 of the preliminary plans for notes.

<u>Element #11 – Maintain BMPs</u>

Maintenance of the BMPs is specified within the Construction Sequence and Grading and Erosion Control Notes. See sheets ER-01 and ER-02 of the preliminary plans for the Construction Sequence and notes.



Element #12: Manage the Project

The Grading and Erosion Control Notes specify seasonal work limitations. Maintenance of the BMPs is specified within the Construction Sequence and Grading and Erosion Control Notes. See sheets ER-01 and ER-02 of the preliminary plans for the Construction Sequence and notes.

Element #13: Protect on-site stormwater management BMPs

On-site stormwater management BMPs used for runoff from roofs and other hard surfaces are not feasible due to soil conditions and proposed project density.



SECTION 3: DOWNSTREAM ANALYSIS

Task 1. Study Area Definition and Maps

Snohomish County Bare Earth LiDAR, survey, and 2021 aerial photography were the best topographical references available for the area containing the site. The limits of the downstream analysis extend roughly 0.25 miles beyond the subject property's natural discharge location.

Task 2. Resource Review

All of the resources below have been reviewed for existing and potential issues near the project site:

Adopted Basin Plans

No Adopted Basin Plans were located that include the project site.

Drainage Basin

This site is in the Allen Creek subbasin, within the Snohomish watershed. Discharge from the proposed development will discharge into Grace Creek, a tributary of Allen Creek, which eventually discharges into Ebey Slough.

Floodplain / Floodway (FEMA) maps

Per FEMA Floodplain map #53061C0736F the subject property is not within a floodplain.

Critical Areas Map

No critical areas have been identified on, or immediately adjacent to, the project site.

Drainage Complaints

No relevant issues were identified near the proposed site.

Road Drainage Problems

No issues were identified near the proposed site.

Soil Survey

Site soils are classified as Norma loam (0 to 3 percent slopes) which is classified as a Hydrologic Soil Group B/D type soil and Tokul gravelly medial loam (0 to 30 percent slopes) which is classified as a Hydrologic Soil Group B type soil.

Wetland Inventory Maps

Wetlands are identified to be on, or immediately adjacent to, the project site. Reference the critical areas report submitted with this report for additional information regarding the wetland areas onsite.

Migrating River Studies

Migrating River Studies are not considered applicable to the proposed development.

Section 303d List of Polluted Waters

Washington State Department of Ecology's Water Quality Assessment for Washington contains no listings for the Grace Creek upstream and downstream of the project.

Water Quality Problems

Grace Creek has no listings in the DOE Water Quality Assessment Review tools. No water quality problems were identified which would be exacerbated by the proposed development.

Stormwater Compliance Plans



Not applicable to the proposed project.

Task 3. Field Inspection/Downstream Analysis

On June 27th, 2022, a Downstream Analysis was performed at the site. The weather consisted of 84 °F and sunny skies. The following observations were verified during the visit.

The subject property areas consist primarily of lawn and forested area. There is a partially developed area in the existing condition with a gravel road leading to a cellular tower in the eastern portion of the site and a steel shipping container in the mid-western portion.

A flow path has been identified flowing from the southeast to the northwest within the threshold discharge area. Runoff generated onsite and within the 700 ft 60th St NE frontage collects within the wetland in the southwest portion of the site before continuing northwest into Grace Creek, a tributary of Allen Creek. The flowpath leaves the site and continues north west about 1200 ft before passing underneath 64th St NE through a culvert. The flow then continues north and west past the 1/4-mile boundary of this analysis. See Figure 3.0, "Downstream Analysis Map" in Appendix 3 for a visual representation of current discharge.

A small amount of upstream flow occurs from the west along 60th St NE and upgradient vegetated area to the west (see image 2). This area drains to the wetland low point onsite and conveys north and west following the same flow path. None of this upstream area will be collected or captured by project improvements.

Task 4. Drainage System Description and Problem Descriptions

Based on the information available and all the resources available including visual inspection of the downstream flow path to the 1/4-mile boundary, there is no evidence of existing or anticipated downstream drainage problems. All flows are adequately carried through natural channels to Ebey Slough.

Task 5. Mitigation of Existing or Potential Drainage Problems


No evidence of existing or potential problems with downstream drainage conveyance infrastructure was found. Mitigation is not required.

Job No.: C22-177



Appendix 3: Resource Review

- 1. Figure 3.0 Downstream Analysis Map
- 2. Downstream Analysis Photographs
- 3. USDA Soils Map & Description
- 4. FEMA Floodplain Map Panel #53061C0736F

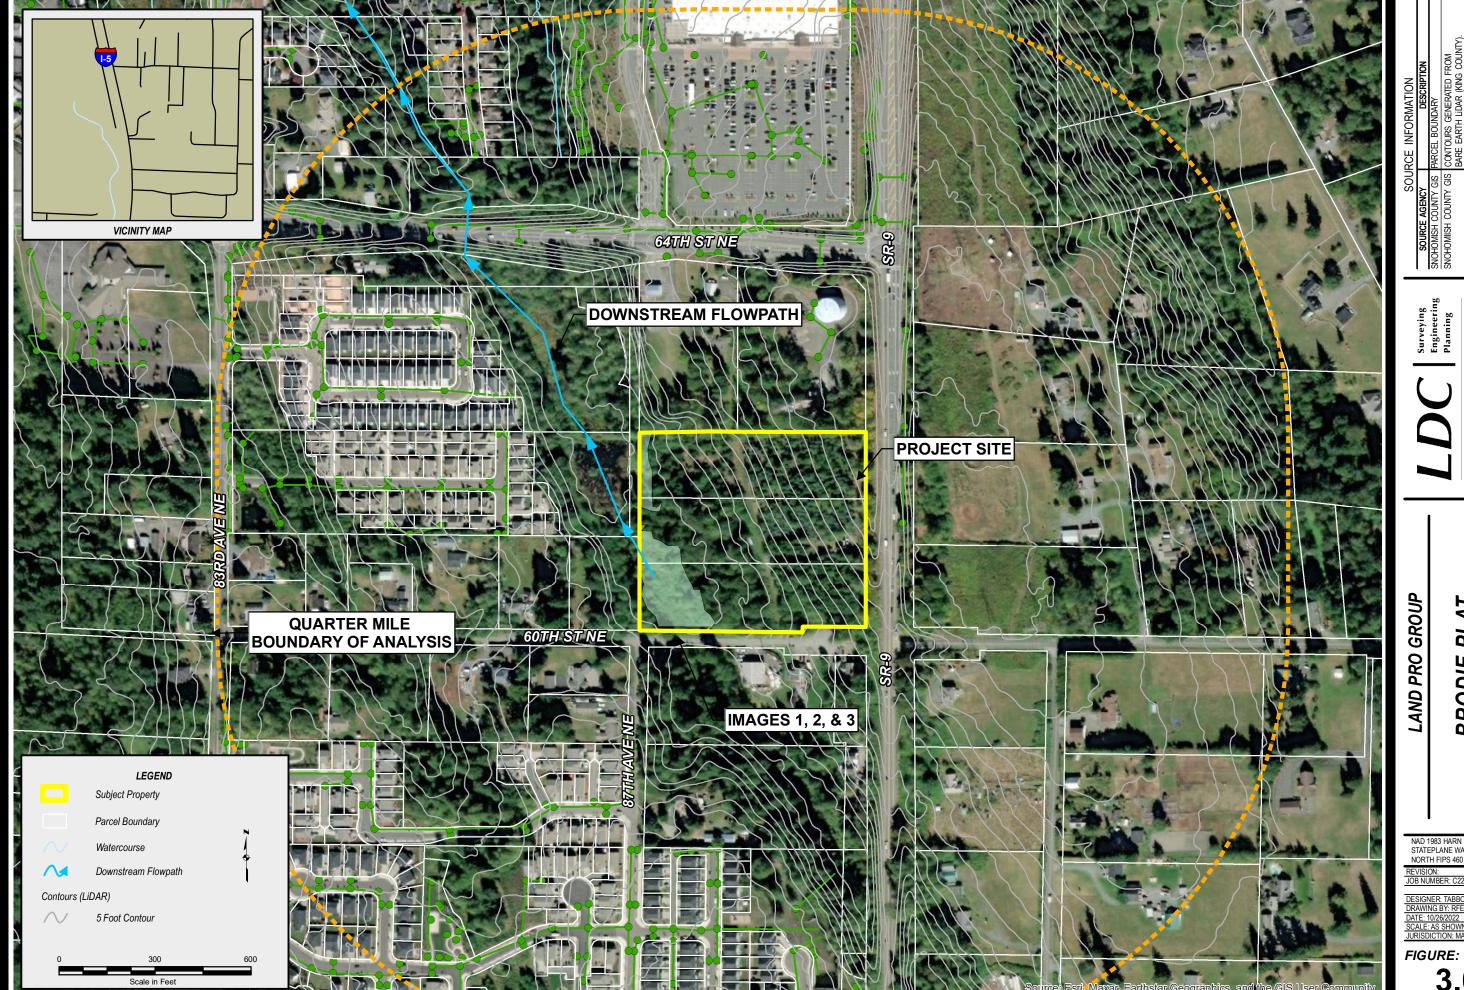

BRODIE PLAT DOWNSTREAM ANALYSIS MAP

NAD 1983 HARN STATEPLANE WASHINGTON NORTH FIPS 4601 FEET

REVISION: JOB NUMBER: C22-17



Downstream Analysis Photographs



Image 1: Low point along 60th St NE. Frontage runoff drains to this point and enters the onsite wetland before continuing north and west.





Image 2: Upstream area that flows along 60th St NE to the low point and into the onsite wetland area.





Image 3: Looking north from 60th St NE, flow travels north and west through the wetland from here before entering Grace Creek.




MAP LEGEND

Area of Interest (AOI)

Area of Interest (AOI)

Soils

Soil Map Unit Polygons

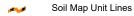

Soil Map Unit Points

Special Point Features

Blowout

Borrow Pit

Clay Spot

Closed Depression

Gravel Pit

Gravelly Spot

Landfill

Lava Flow

Marsh or swamp

Waish of Swall

Mine or Quarry

Miscellaneous Water

Perennial Water

→ Saline Spot

Sandy Spot

Severely Eroded Spot

Sinkhole

Slide or Slip

Sodic Spot

Spoil Area

Stony Spot

Very Stony Spot

Wet Spot

Other

Special Line Features

Water Features

Δ

Streams and Canals

Transportation

Rails

Interstate Highways

US Routes

Major Roads

Local Roads

Background

Aerial Photography

MAP INFORMATION

The soil surveys that comprise your AOI were mapped at 1:24.000.

Warning: Soil Map may not be valid at this scale.

Enlargement of maps beyond the scale of mapping can cause misunderstanding of the detail of mapping and accuracy of soil line placement. The maps do not show the small areas of contrasting soils that could have been shown at a more detailed scale

Please rely on the bar scale on each map sheet for map measurements.

Source of Map: Natural Resources Conservation Service Web Soil Survey URL:

Coordinate System: Web Mercator (EPSG:3857)

Maps from the Web Soil Survey are based on the Web Mercator projection, which preserves direction and shape but distorts distance and area. A projection that preserves area, such as the Albers equal-area conic projection, should be used if more accurate calculations of distance or area are required.

This product is generated from the USDA-NRCS certified data as of the version date(s) listed below.

Soil Survey Area: Snohomish County Area, Washington Survey Area Data: Version 23, Aug 31, 2021

Soil map units are labeled (as space allows) for map scales 1:50.000 or larger.

Date(s) aerial images were photographed: Aug 16, 2020—Aug 19, 2020

The orthophoto or other base map on which the soil lines were compiled and digitized probably differs from the background imagery displayed on these maps. As a result, some minor shifting of map unit boundaries may be evident.

Map Unit Legend

Map Unit Symbol	Map Unit Name	Acres in AOI	Percent of AOI
39	Norma loam	2.6	25.5%
72	Tokul gravelly medial loam, 0 to 8 percent slopes	3.1	30.7%
73	Tokul gravelly medial loam, 8 to 15 percent slopes	3.5	34.6%
74	Tokul gravelly medial loam, 15 to 30 percent slopes	0.9	9.3%
Totals for Area of Interest		10.1	100.0%

National Flood Hazard Layer FIRMette




Basemap: USGS National Map: Orthoimagery: Data refreshed October, 2020



Legend

SEE FIS REPORT FOR DETAILED LEGEND AND INDEX MAP FOR FIRM PANEL LAYOUT

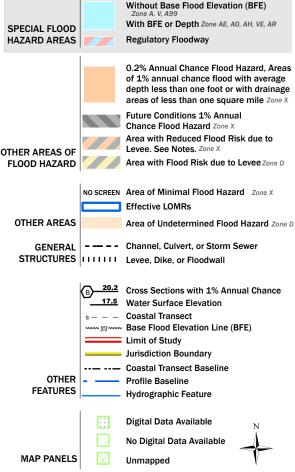

This map complies with FEMA's standards for the use of digital flood maps if it is not void as described below. The basemap shown complies with FEMA's basemap accuracy standards

The pin displayed on the map is an approximate point selected by the user and does not represent

an authoritative property location.

The flood hazard information is derived directly from the authoritative NFHL web services provided by FEMA. This map was exported on 1/25/2023 at 11:30 AM and does not reflect changes or amendments subsequent to this date and time. The NFHL and effective information may change or become superseded by new data over time.

This map image is void if the one or more of the following map elements do not appear: basemap imagery, flood zone labels, legend, scale bar, map creation date, community identifiers, FIRM panel number, and FIRM effective date. Map images for unmapped and unmodernized areas cannot be used for regulatory purposes.



SECTION 4: DETENTION AND WATER QUALITY TREATMENT DESIGN

4.1 Pre-Developed Hydrology/Land Cover

The pre-developed and developed conditions were modeled in WWHM for the purpose of peak flow determination for direct discharge. Based on the site location, the WWHM used the Everett Gage and a Precipitation Scale factor of 1.2.

Onsite Basin:

The predeveloped condition applied to the Onsite and Bypass Basins, modeled as a combined single basin. It does not include the wetland buffer area onsite that will not be disturbed for development. For visual representation of the listed basins, see Figure 4.0, "Predeveloped Hydrology Map". The values as modeled in WWHM are as follows:

Table 1: Predeveloped Conditions: Onsite Basin

Onsite Basin			
Ground Cover Area (acre)			
Forest, mod	1.31		
Forest, steep 5.77			
Total 7.08			

4.2 Developed Site Hydrology

In the developed condition, the project will develop 44 single-family lots and associated driveways and utilities. Frontage improvements, including pavement widening and construction of pedestrian facilities, will be constructed along 60th St NE.

In compliance with the 2014 DOE Manual, all runoff from onsite developed/disturbed surfaces will be collected, treated, and discharged directly to existing/historic flow paths.

Onsite Basin:

The developed Onsite Basin is 6.43 acres comprised of a 44 single family lots, open spaces, and ROW. A 70% impervious lot coverage assumption per lot was used. In the developed condition, the Onsite Basin has been modeled using WWHM with the following areas and ground cover designations:

Table 2: Developed Conditions: Onsite Basin

Onsite Basin			
Ground Cover	Area (acre)		
Roof tops	2.43		
Roads, flat	1.26		
Driveway, flat	0.40		
Sidewalks, flat	0.46		
Pasture, flat	1.88		
Total	6.43		



Bypass Basin:

The developed Bypass Basin is 0.65 acres and is comprised of proposed frontage improvements along 60th St NE, including pavement widening, planters, and pedestrian accesses along with some onsite ROW area. A portion of the lawn area on the west edge of lots 26-30 cannot be collected due to vertical constraints. This area has been added to the frontage bypass to make up the 0.20 acres of pasture in the model. The Bypass Basin cannot be collected due to topographical constraints. The Bypass Basin was modeled using WWHM with the following areas and ground cover designations:

Bypass Basin

Ground Cover Area (acre)

Roads, flat 0.28

Sidewalk, flat 0.17

Pasture, Flat 0.20

Total 0.65

Table 3: Developed Conditions: Bypass Basin

4.3 Detention Facility Design

The proposed detention vault facility used for mitigating developed condition flows was designed in compliance with 2014 DOE requirements to model hydrologic conditions and detention in a continuous runoff model (WWHM2012) where the following evaluation parameters are employed:

"Flow duration is computed by counting the number of flow values that exceed a specified flow level. The specified flow levels used by WWHM in the flow duration analysis are listed below.

- 1. 50% of the 2-year predevelopment peak flow.
- 2. 100% of the 2-year predevelopment peak flow.
- 3. 100% of the 50-year predevelopment peak flow.

There are three criteria by which flow duration values are compared:

- 1. If the postdevelopment flow duration values exceed any of the predevelopment flow levels between 50% and 100% of the 2-year predevelopment peak flow values (100 Percent Threshold) then the flow duration requirement has not been met.
- 2. If the postdevelopment flow duration values exceed any of the predevelopment flow levels between 100% of the 2-year and 100% of the 50-year predevelopment peak flow values more than 10 percent of the time (110 Percent Threshold) then the flow duration requirement has not been met.
- 3. If more than 50 percent of the flow duration levels exceed the 100 percent threshold then the flow duration requirement has not been met."

Detention Vault Facility

The proposed detention facility detains, and releases collected storm water runoff from the Onsite Basin. The facility is located within Tract 998 in the northwestern corner of the site. Flows from the Onsite Basin are collected and conveyed to the detention vault via a proposed network of catch basins and storm water conveyance pipes. Detailed WWHM output is provided in Appendix 4. A summary of the detailed statistics and inputs used for modeling the system in WWHM2012 can be found below.



Table 4: Detention Vault Design Summary

Detention Vault			
Live Storage Bottom Area (modeled)	10,140 SF		
Live Storage Bottom Area (provided)	10,168 SF		
Number of Cells	8		
Cell Dimensions	4 ea x 15.5' x 68' & 4 ea x 15.5' x 96'		
Begin Live Storage Elevation	401.00		
Riser Height	8.00′		
Volume (modeled)	81,120 CF		
Volume (provided)	81,344 CF		
Top of Riser Elevation	409.00		
Top Outside of Vault Elevation	410.50		

See table below for the flow rates and water surface elevations by storm event for the detention vault.

Table 5: Flow Rates and Water Surface Elevations by Storm Event

Storm Event	Predeveloped Rate (cfs)	Mitigated Rates (cfs)	Water Surface Elevation (ft)
2-Year	0.3515	0.3526	405.73
10-Year	0.7600	0.5693	407.25
50-Year	1.3064	0.8121	409.02
100-Year	1.6045	0.9322	409.06



4.4 Water Quality Treatment

Perkfilter

Water Quality Treatment for the Onsite Basin is accomplished through a Perkfilter structure located downstream of the detention vault. A summary of design criteria is provided below:

Table 6: Perkfilter Design Summary

Ø Perkfilter Vault			
Tributary Area	6.43 AC		
Tributary PGIS Area	1.66 AC		
Water Quality Flow Rate (2 yr mitigated peak)	0.1780 cfs		
WQ Treatment Capacity	0.1900 cfs		
Number of Cartridges	7		
Cartridge Height	12"		
Internal Drop	1.7'		
Peak Flow Rate	0.9322 cfs		
Peak Flow Storm Event	100-year		

Modular Wetland

Water Quality Treatment for the Bypass Basin is accomplished through a Modular Wetland structure located in Tract 991. The Modular Wetland treats all stormwater that cannot be collected by the detention vault prior to discharge. A summary of design criteria is provided below:

Table 7: Modular Wetland Design Summary


Modular Wetland			
Tributary Area	0.65 AC		
Tributary PGIS Area	0.28 AC		
Water Quality Flow Rate (91% of total volume)	0.0840 cfs		
WQ Treatment Capacity	0.103 cfs		
Number of Cartridges	N/A		
Cartridge Height	N/A		
Internal Drop	0.5′		
Peak Flow Rate	0.6465 cfs		
Peak Flow Storm Event	100-year		




Appendix 4: Detention and Water Quality Design Analysis

- 1. Figure 4.0: Predeveloped Hydrology Map
- 2. Figure 5.0: Developed Hydrology Map
- 3. Perkfilter Detail
- 4. Modular Wetland Detail
- 5. WWHM2012 Output – Detention Vault
- 6. WWHM2012 Output - Perkfilter - Onsite Basin
- 7. WWHM2012 Output – Modular Wetland - Frontage Bypass

Job No.: C22-177

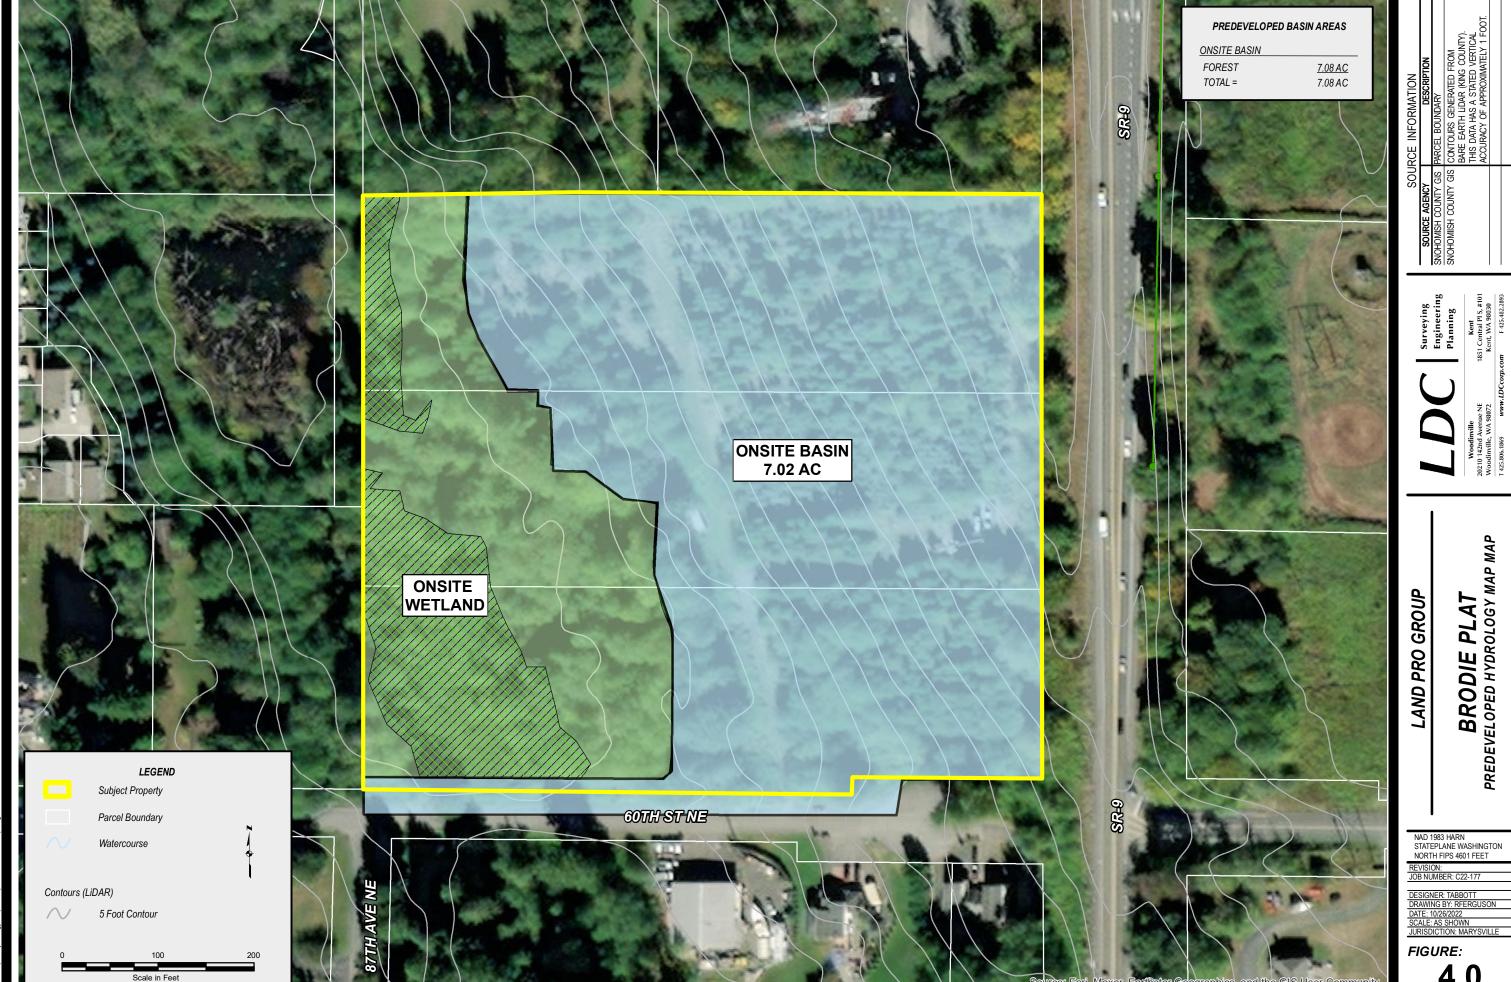

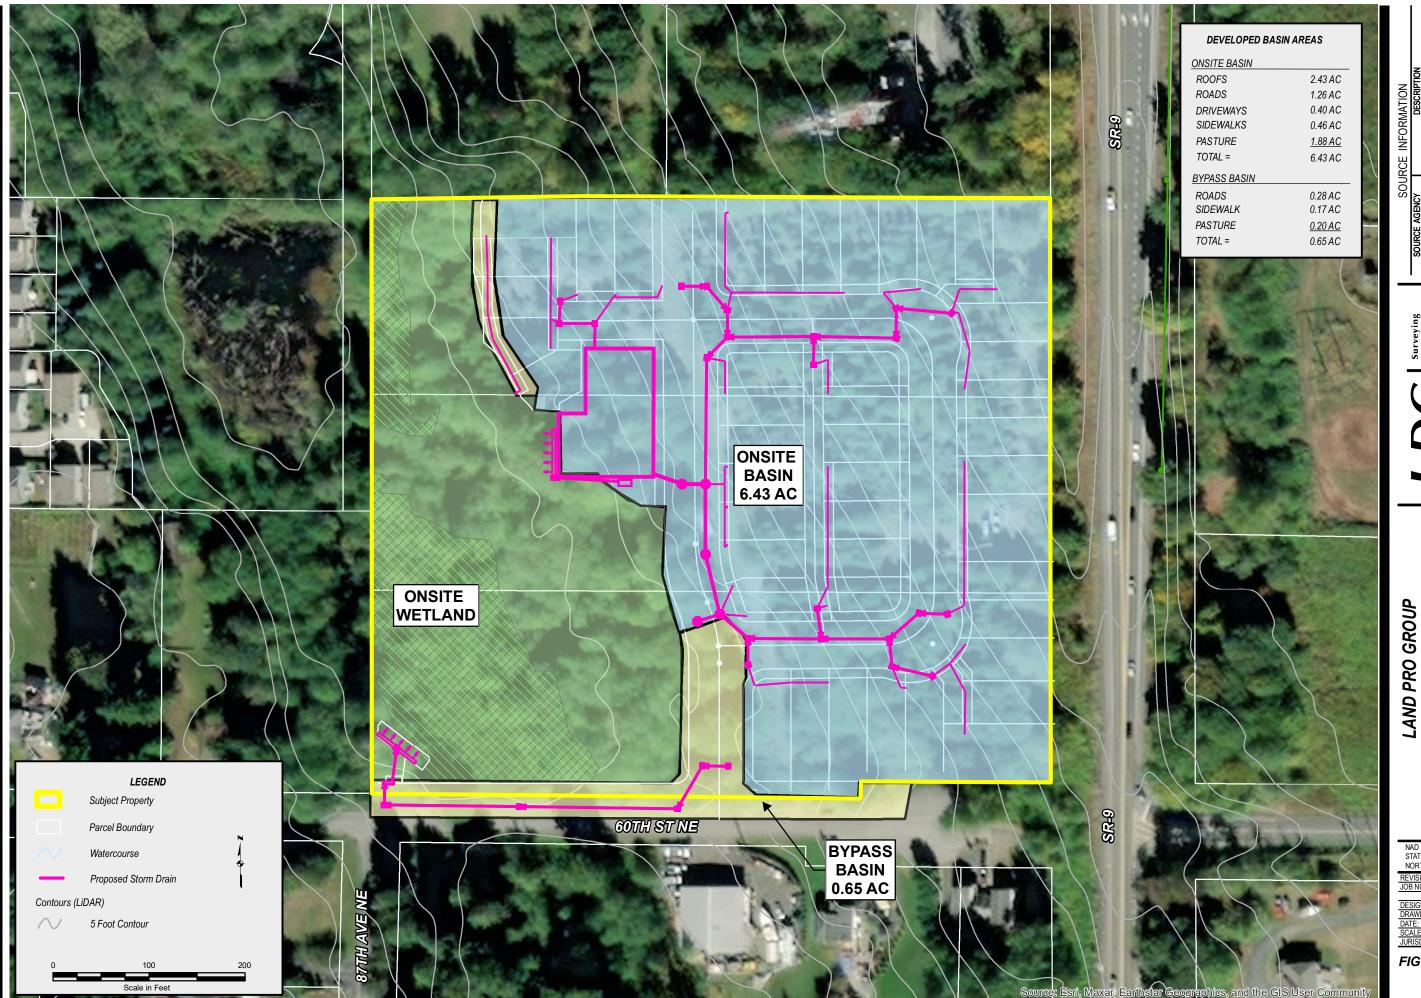

BRODIE PLAT DEVELOPED HYDROLOGY MAP


NAD 1983 HARN STATEPLANE WASHINGTON NORTH FIPS 4601 FEET

REVISION: JOB NUMBER: C22-177

DESIGNER: TABBOTT DRAWING BY: RFERGUSON DATE: 1/25/2023 SCALE: AS SHOWN

FIGURE:

5.0

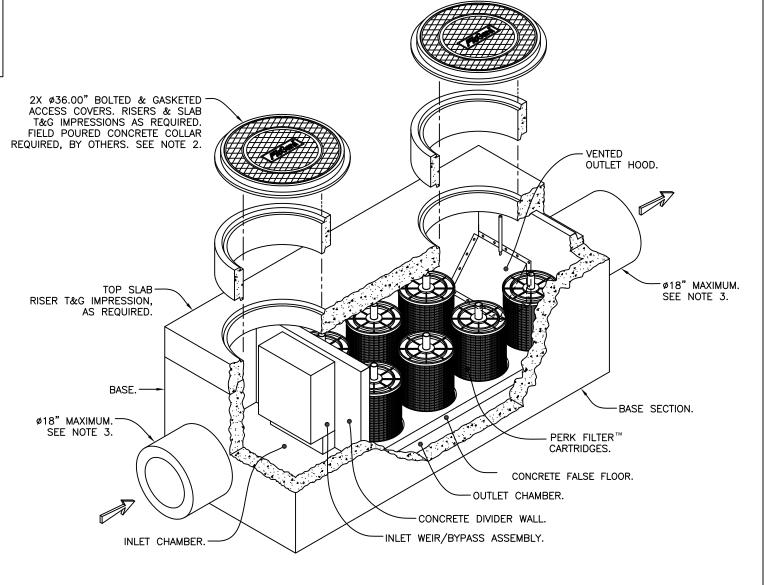

Notes:

- Precast concrete structure shall be manufactured in accordance with ASTM Designation C857 and C858. 1.
- 2. Filter system shall be supplied with traffic rated (H20) bolted & gasketed Ø36" circular access covers with risers as required. Shallow applications may require configurations with (H20) bolted & gasketed square/rectangular access hatches. Field poured concrete collars required, by others.
- Inlet & outlet pipe(s) (Ø 18" maximum) may enter device on all three sides of the inlet & outlet chambers respectively. 3.
- Inlet chamber shall be supplied with a drain-down device designed to remove standing water between storm events. 4.
- For depths less than specified minimums contact Oldcastle® Stormwater Solutions for engineering assistance. 5.







THIS DOCUMENT IS THE PROPERTY OF OLDCASTLE INFRASTRUCTURE, IT IS SUBMITTED FOR REFERENCE PURPOSES ONLY AND SHALL NOT BE USED IN ANY WAY INJURIOUS TO THE INTERESTS OF SAID COMPANY. COPYRIGHT © 2020 OLDCASTLE INFRASTRUCTURE ALL RIGHTS RESERVED

PF-V-4-0001

CJS 6/17/20 SHEET 1 OF 2

Filtration

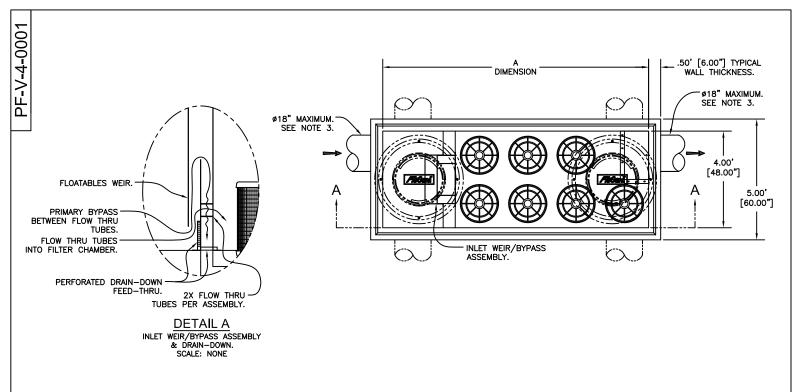

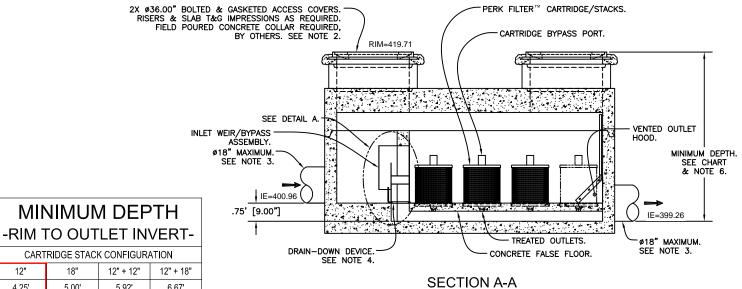

4' VAULT TREATMENT FLOW RATES, TOTAL FLOW CAPACITIES & MAXIMUM HEAD LOSS CARTRIDGE STACK CONFIGURATION CARTRIDGE 12" + 12" 12" + 18" DIMENSION STACK TREATMENT TOTAL FLOW TREATMENT TOTAL FLOW TREATMENT TOTAL FLOW TREATMENT TOTAL FLOW -LENGTH-QUANTITY FLOW RATE CAPACITY CAPACITY FLOW RATE CAPACITY FLOW RATE CAPACITY FLOW RATE (ID - FT) (GPM / CFS) (GPM / CFS) (GPM / CFS) (CFS) (CFS) (GPM / CFS) (CFS) (CFS) 3 8 36 / 0.08 2.9 54 / 0.12 4.3 72 / 0.16 5.0 90 / 0.20 6.7 48 / 0.11 72 / 0.16 96 / 0.21 120 / 0.27 6.8 8 2.9 5.0 4 4.4 5 12 60 / 0.13 2.9 90 / 0.20 4.4 120 / 0.27 5.1 150 / 0.33 6.8 6 12 72 / 0.16 3.0 108 / 0.24 4.5 144 / 0.32 5.1 180 / 0.40 6.9 126 / 0.28 4.5 168 / 0.37 5.2 210 / 0.47 7.0 12 84 / 0.19 3.0 12 144 / 0.32 4.5 192 / 0.43 240 / 0.53 7.0 96 / 0.21 3.0 MAXIMUM HEAD LOSS 2.3 FT 2.9 FT 3.5 FT



12"

4 25'

5.00'

5.92

PerkFilter™

4' Wide Concrete Vault

6.67

Three to Eight Cartridges / Stacks




Oldcastle Infrastructure[™]


A CRH COMPANY

THIS DOCUMENT IS THE PROPERTY OF OLDCASTLE INFRASTRUCTURE. IT IS SUBMITTED FOR REFERENCE PURPOSES ONLY AND SHALL NOT BE USED IN ANY WAY INJURIOUS TO THE INTERESTS OF SAID COMPANY. COPYRIGHT © 2020 OLDCASTLE INFRASTRUCTURE ALL RIGHTS RESERVED.

F CJS 6/17/20 | SHEET 2 OF 2 PF-V-4-0001

	SITE SPEC	IFIC DATA	
PROJECT NUMBER			
PROJECT NAME		BRODIE PLAT	
PROJECT LOCATI	ON	EVERETT, WA	
	TREATMENT	REQUIRED	
VOLUME B	ASED (CF)	FLOW BAS	SED (CFS)
		0.0	840
PEAK BYPASS R	EQUIRED (CFS) -	IF APPLICABLE	0.6465
PIPE DATA	I.E.	MATERIAL	DIAMETER
INLET PIPE	397.24	DI	12"
OUTLET PIPE	396.74	PVC	12"
	PRETREATMENT	BIOFILTRATION	DISCHARGE
RIM ELEVATION	401.92	401.92	401.92
SURFACE LOAD	HS-20	HS-20	HS-20
FRAME & COVER	ø30"	ø30"	N/A
WETLANDMEDIA VOLUME (CY)			1.56
ORIFICE SIZE (DIA. INCHES)			5 EA Ø0.82"

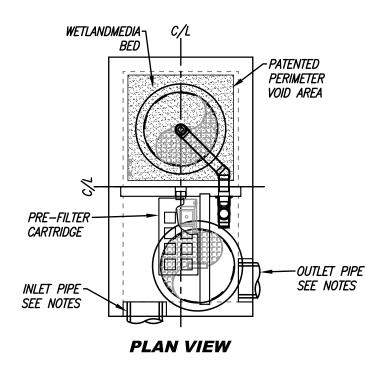

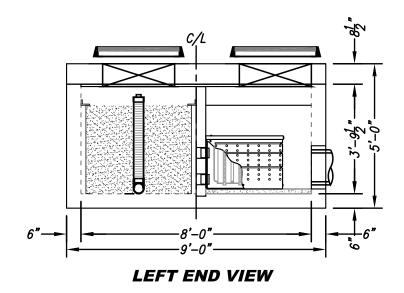


INSTALLATION NOTES

- 1. CONTRACTOR TO PROVIDE ALL LABOR, EQUIPMENT, MATERIALS AND INCIDENTALS REQUIRED TO OFFLOAD AND INSTALL THE SYSTEM AND APPURTENANCES IN ACCORDANCE WITH THIS DRAWING AND THE MANUFACTURERS' SPECIFICATIONS, UNLESS OTHERWISE STATED IN MANUFACTURER'S CONTRACT.
- 2. UNIT MUST BE INSTALLED ON LEVEL BASE. MANUFACTURER
 RECOMMENDS A MINIMUM 6" LEVEL ROCK BASE UNLESS SPECIFIED BY
 THE PROJECT ENGINEER. CONTRACTOR IS RESPONSIBLE FOR VERIFYING
 PROJECT ENGINEER'S RECOMMENDED BASE SPECIFICATIONS.
- 4. CONTRACTOR TO SUPPLY AND INSTALL ALL EXTERNAL CONNECTING PIPES. ALL PIPES MUST BE FLUSH WITH INSIDE SURFACE OF CONCRETE (PIPES CANNOT INTRUDE BEYOND FLUSH). INVERT OF OUTFLOW PIPE MUST BE FLUSH WITH DISCHARGE CHAMBER FLOOR. ALL PIPES SHALL BE SEALED WATERTIGHT PER MANUFACTURER'S STANDARD CONNECTION DETAIL.
- 5. CONTRACTOR RESPONSIBLE FOR INSTALLATION OF ALL PIPES, RISERS, MANHOLES, AND HATCHES. CONTRACTOR TO GROUT ALL MANHOLES AND HATCHES TO MATCH FINISHED SURFACE UNLESS SPECIFIED OTHERWISE.
- 6. VEGETATION SUPPLIED AND INSTALLED BY OTHERS. ALL UNITS WITH VEGETATION MUST HAVE DRIP OR SPRAY IRRIGATION SUPPLIED AND INSTALLED BY OTHERS.
- 7. CONTRACTOR RESPONSIBLE FOR CONTACTING BIO CLEAN FOR ACTIVATION OF UNIT. MANUFACTURER'S WARRANTY IS VOID WITHOUT PROPER ACTIVATION BY A BIO CLEAN REPRESENTATIVE.

GENERAL NOTES

 MANUFACTURER TO PROVIDE ALL MATERIALS UNLESS OTHERWISE NOTED.
 ALL DIMENSIONS, ELEVATIONS, SPECIFICATIONS AND CAPACITIES ARE SUBJECT TO CHANGE. FOR PROJECT SPECIFIC DRAWINGS DETAILING EXACT DIMENSIONS, WEIGHTS AND ACCESSORIES PLEASE CONTACT BIO CLEAN.

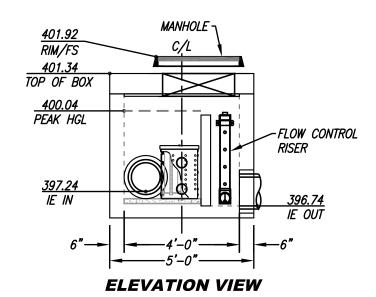

INTERNAL BYPASS DISCLOSURE:

THE DESIGN AND CAPACITY OF THE PEAK CONVEYANCE METHOD TO BE REVIEWED AND APPROVED BY THE ENGINEER OF RECORD. HGL(S) AT PEAK FLOW SHALL BE ASSESSED TO ENSURE NO UPSTREAM FLOODING. PEAK HGL AND BYPASS CAPACITY SHOWN ON DRAWING ARE USED FOR GUIDANCE ONLY.



PROPRIETARY AND CONFIDENTIAL:

THE INFORMATION CONTAINED IN THIS DOCUMENT IS THE SOLE PROPERTY OF FORTERRA AND ITS COMPANIES. THIS DOCUMENT, NOR ANY PART THEREOF, MAY BE USED, REPRODUCED OR MODIFIED IN ANY MANNER WITH OUT THE WRITTEN CONSENT OF FORTERRA.



TREATMENT FLOW (CFS)

OPERATING HEAD (FT)

PRETREATMENT LOADING RATE (GPM/SF)

1.8

WETLAND MEDIA LOADING RATE (GPM/SF)

1.0

RIGHT END VIEW

MWS-L-4-8-3'-10"-V-UG STORMWATER BIOFILTRATION SYSTEM STANDARD DETAIL



WWHM2012 PROJECT REPORT

Project Name: Brodie Vault

Site Name: Brodie
Site Address:

City : Marysville
Report Date: 1/18/2023
Gage : Everett
Data Start : 1948/10/01

Data End: 2009/09/30
Precip Scale: 1.20
Version Date: 2021/08/18

Version : 4.2.18

Low Flow Threshold for POC 1 : 50 Percent of the 2 Year

High Flow Threshold for POC 1: 50 year

PREDEVELOPED LAND USE

Name : Onsite
Bypass: No

GroundWater: No

 Pervious Land Use
 acre

 C, Forest, Mod
 1.31

 C, Forest, Steep
 5.77

Pervious Total 7.08

Impervious Land Use acre

Impervious Total 0

Basin Total 7.08

Element Flows To:

Surface Interflow Groundwater

MITIGATED LAND USE

Name : Onsite

Bypass: No





GroundWater: No

Pervious Land Use C, Pasture, Flat	<u>acre</u> 1.88
Pervious Total	1.88
Impervious Land Use	<u>acre</u> 1.26
ROOF TOPS FLAT	2.43
DRIVEWAYS FLAT	0.4
SIDEWALKS FLAT	0.46
Impervious Total	4.55
Basin Total	6.43

Element Flows To:

Surface Interflow Groundwater

Vault 1 Vault 1

Name : Bypass Basin

Bypass: Yes

GroundWater: No

Perv	vious Land	d Use	acre
С,	Pasture,	Flat	. 2

Pervious Total 0.2

Impervious Land Use	acre
ROADS FLAT	0.28
SIDEWALKS FLAT	0.17

Impervious Total 0.45

Basin Total 0.65

Element Flows To:

Surface Interflow Groundwater

Name : Vault 1



Width: 169 ft.

Length: 60 ft.

Depth: 9 ft.

Discharge Structure

Riser Height: 8 ft.

Riser Diameter: 12 in.

Orifice 1 Diameter: 1.78125 in. Elevation: 0 ft. Orifice 2 Diameter: 1.75 in. Elevation: 3.9 ft. Orifice 3 Diameter: 2.5 in. Elevation: 4.45 ft.

Element Flows To:

Outlet 1 Outlet 2

Vault Hydraulic Table

vault hydraulic labie						
Stage(feet)	Area(ac.)			Infilt(cfs)		
0.0000	0.232	0.000	0.000	0.000		
0.1000	0.232	0.023	0.027	0.000		
0.2000	0.232	0.046	0.038	0.000		
0.3000	0.232	0.069	0.047	0.000		
0.4000	0.232	0.093	0.054	0.000		
0.5000	0.232	0.116	0.060	0.000		
0.6000	0.232	0.139	0.066	0.000		
0.7000	0.232	0.162	0.072	0.000		
0.8000	0.232	0.186	0.077	0.000		
0.9000	0.232	0.209	0.081	0.000		
1.0000	0.232	0.232	0.086	0.000		
1.1000	0.232	0.256	0.090	0.000		
1.2000	0.232	0.279	0.094	0.000		
1.3000	0.232	0.302	0.098	0.000		
1.4000	0.232	0.325	0.101	0.000		
1.5000	0.232	0.349	0.105	0.000		
1.6000	0.232	0.372	0.108	0.000		
1.7000	0.232	0.395	0.112	0.000		
1.8000	0.232	0.419	0.115	0.000		
1.9000	0.232	0.442	0.118	0.000		
2.0000	0.232	0.465	0.121	0.000		
2.1000	0.232	0.488	0.124	0.000		
2.2000	0.232	0.512	0.127	0.000		
2.3000	0.232	0.535	0.130	0.000		
2.4000	0.232	0.558	0.133	0.000		
2.5000	0.232	0.582	0.136	0.000		
2.6000	0.232	0.605	0.138	0.000		
2.7000	0.232	0.628	0.141	0.000		
2.8000	0.232	0.651	0.144	0.000		
2.9000	0.232	0.675	0.146	0.000		
3.0000	0.232	0.698	0.149	0.000		
3.1000	0.232	0.721	0.151	0.000		
3.2000	0.232	0.744	0.154	0.000		
3.3000	0.232	0.768	0.156	0.000		
3.4000	0.232	0.791	0.158	0.000		
3.5000	0.232	0.814	0.161	0.000		
3.6000	0.232	0.838	0.163	0.000		



3.7000	0.232	0.861	0.165	0.000
3.8000	0.232	0.884	0.167	0.000
3.9000	0.232	0.907	0.170	0.000
4.0000	0.232	0.931	0.198	0.000
4.1000	0.232	0.954	0.211	0.000
Stage (feet)	Area(ac.)	Volume (ac-ft.)		Infilt(cfs)
4.2000	0.232	0.977	0.222	0.000
4.3000	0.232	1.001	0.231	0.000
4.4000	0.232	1.024	0.231	0.000
4.5000	0.232	1.047	0.284	
				0.000
4.6000	0.232	1.070	0.319	0.000
4.7000	0.232	1.094	0.345	0.000
4.8000	0.232	1.117	0.367	0.000
4.9000	0.232	1.140	0.387	0.000
5.0000	0.232	1.163	0.405	0.000
5.1000	0.232	1.187	0.422	0.000
5.2000	0.232	1.210	0.438	0.000
5.3000	0.232	1.233	0.452	0.000
5.4000	0.232	1.257	0.467	0.000
5.5000	0.232	1.280	0.480	0.000
5.6000	0.232	1.303	0.494	0.000
5.7000	0.232	1.326	0.506	0.000
5.8000		1.350		
	0.232		0.519	0.000
5.9000	0.232	1.373	0.530	0.000
6.0000	0.232	1.396	0.542	0.000
6.1000	0.232	1.420	0.553	0.000
6.2000	0.232	1.443	0.564	0.000
6.3000	0.232	1.466	0.575	0.000
6.4000	0.232	1.489	0.586	0.000
6.5000	0.232	1.513	0.596	0.000
6.6000	0.232	1.536	0.606	0.000
6.7000	0.232	1.559	0.616	0.000
6.8000	0.232	1.582	0.626	0.000
6.9000	0.232	1.606	0.635	0.000
7.0000	0.232	1.629	0.645	0.000
7.1000	0.232	1.652	0.654	0.000
7.2000	0.232	1.676	0.663	0.000
7.3000	0.232	1.699	0.672	0.000
	0.232	1.722		
7.4000			0.681	0.000
7.5000	0.232	1.745	0.689	0.000
7.6000	0.232	1.769	0.698	0.000
7.7000	0.232	1.792	0.706	0.000
7.8000	0.232	1.815	0.715	0.000
7.9000	0.232	1.839	0.723	0.000
8.0000	0.232	1.862	0.731	0.000
8.1000	0.232	1.885	1.072	0.000
8.2000	0.232	1.908	1.655	0.000
8.3000	0.232	1.932	2.264	0.000
8.4000	0.232	1.955	2.723	0.000
8.5000	0.232	1.978	2.973	0.000
8.6000	0.232	2.001	3.217	0.000
8.7000	0.232	2.025	3.420	0.000
8.8000	0.232	2.048	3.610	0.000
8.9000	0.232	2.048	3.788	0.000
	0.232			
9.0000		2.095	3.957	0.000
9.1000	0.232	2.118	4.118	0.000



9.2000 0.000 0.000 4.272 0.000

ANALYSIS RESULTS

Stream Protection Duration

Predeveloped Landuse Totals for POC #1

Total Pervious Area:7.08
Total Impervious Area:0

Mitigated Landuse Totals for POC #1

Total Pervious Area:2.08 Total Impervious Area:5

Flow Frequency Return Periods for Predeveloped. POC #1

Return Period	Flow(cfs)
2 year	0.351495
5 year	0.573062
10 year	0.759995
25 year	1.048689
50 year	1.306358
100 year	1.604527

Flow Frequency Return Periods for Mitigated. POC #1

Return Period	Flow(cfs)
2 year	0.352585
5 year	0.475749
10 year	0.569333
25 year	0.702084
50 year	0.812097
100 year	0.932164

Stream Protection Duration

Annual Peaks for Predeveloped and Mitigated. POC #1

Ailliuai .	reaks for Fredevero	TOT Predeverobed and writing		
Year	Predeveloped	Mitigated		
1949	0.381	0.341		
1950	0.429	0.383		
1951	0.307	0.340		
1952	0.286	0.309		
1953	0.252	0.366		
1954	1.316	0.491		
1955	0.437	0.353		
1956	0.362	0.279		
1957	0.487	0.384		
1958	1.176	0.651		
1959	0.318	0.315		
1960	0.341	0.323		



1962 0.355 0.3419 1963 0.583 0.419 1964 0.412 0.247 1965 0.256 0.250 1966 0.181 0.253 1967 0.358 0.568 1968 0.443 0.361 1969 1.147 0.631 1970 0.228 0.277 1971 0.410 0.331 1972 0.288 0.470 1973 0.247 0.357 1974 0.688 0.438 1975 0.303 0.351 1976 0.257 0.319 1977 0.224 0.285 1978 0.243 0.262 1979 0.704 0.459 1980 0.332 0.273 1981 0.240 0.269 1982 0.328 0.410 1983 0.596 0.326 1984 0.296 0.375 1985 0.405 0.411 1986 0.905 0.797	1961	1.429	0.858
1964 0.412 0.256 0.250 1966 0.181 0.253 1967 0.358 0.568 1968 0.443 0.361 1969 1.147 0.631 1970 0.228 0.277 1971 0.410 0.331 1972 0.288 0.470 1973 0.247 0.357 1974 0.688 0.438 1975 0.303 0.351 1976 0.257 0.319 1977 0.224 0.285 1978 0.243 0.262 1979 0.704 0.459 1980 0.332 0.273 1981 0.240 0.269 1982 0.328 0.410 1983 0.596 0.326 1984 0.296 0.375 1985 0.405 0.411 1986 0.905 0.797 1989 0.300 0.307 1990 0.273 0.280 1991 0.292 0.281 <td>1962</td> <td>0.355</td> <td>0.342</td>	1962	0.355	0.342
1965 0.256 0.250 1966 0.181 0.253 1967 0.358 0.568 1968 0.443 0.361 1969 1.147 0.631 1970 0.228 0.277 1971 0.410 0.331 1972 0.288 0.470 1973 0.247 0.357 1974 0.688 0.438 1975 0.303 0.351 1976 0.257 0.319 1977 0.224 0.285 1978 0.243 0.262 1979 0.704 0.459 1980 0.332 0.273 1981 0.240 0.269 1982 0.328 0.410 1983 0.596 0.326 1984 0.296 0.375 1985 0.405 0.411 1986 0.905 0.797 1987 0.300 0.307 1990 0.273 0.280 1991 0.292 0.281			
1966 0.181 0.253 1967 0.358 0.568 1968 0.443 0.361 1969 1.147 0.631 1970 0.228 0.277 1971 0.410 0.331 1972 0.288 0.470 1973 0.247 0.357 1974 0.688 0.438 1975 0.303 0.351 1976 0.257 0.319 1977 0.224 0.285 1978 0.243 0.262 1979 0.704 0.459 1980 0.332 0.273 1981 0.240 0.269 1982 0.328 0.410 1983 0.596 0.375 1984 0.296 0.375 1985 0.405 0.411 1986 0.905 0.797 1987 0.397 0.533 1989 0.300 0.307 1990 0.273 0.280 1991 0.292 0.281			
1967 0.358 0.568 1968 0.443 0.361 1969 1.147 0.631 1970 0.228 0.277 1971 0.410 0.331 1972 0.288 0.470 1973 0.247 0.357 1974 0.688 0.438 1975 0.303 0.351 1976 0.257 0.319 1977 0.224 0.285 1978 0.243 0.262 1979 0.704 0.459 1980 0.332 0.273 1981 0.240 0.269 1982 0.328 0.410 1983 0.596 0.326 1984 0.296 0.375 1985 0.405 0.411 1986 0.905 0.797 1987 0.397 0.533 1989 0.300 0.307 1990 0.273 0.280 1991 0.292 0.281 1992 0.244 0.309			
1968 0.443 0.361 1969 1.147 0.631 1970 0.228 0.277 1971 0.410 0.331 1972 0.288 0.470 1973 0.247 0.357 1974 0.688 0.438 1975 0.303 0.351 1976 0.257 0.319 1977 0.224 0.285 1978 0.243 0.262 1979 0.704 0.459 1980 0.332 0.273 1981 0.240 0.269 1982 0.328 0.410 1983 0.596 0.326 1984 0.296 0.375 1985 0.405 0.411 1986 0.905 0.797 1987 0.397 0.533 1989 0.300 0.307 1990 0.273 0.280 1991 0.292 0.281 1992 0.244 0.309 1993 0.242 0.261			
1970 0.228 0.277 1971 0.410 0.331 1972 0.288 0.470 1973 0.247 0.357 1974 0.688 0.438 1975 0.303 0.351 1976 0.257 0.319 1977 0.224 0.285 1978 0.243 0.262 1979 0.704 0.459 1980 0.332 0.273 1981 0.240 0.269 1982 0.328 0.410 1983 0.596 0.326 1984 0.296 0.375 1985 0.405 0.411 1986 0.905 0.797 1987 0.397 0.533 1988 0.239 0.292 1989 0.300 0.307 1990 0.273 0.280 1991 0.292 0.281 1992 0.244 0.309 1993 0.242 0.261 1994 0.209 0.281			
1971 0.410 0.331 1972 0.288 0.470 1973 0.247 0.357 1974 0.688 0.438 1975 0.303 0.351 1976 0.257 0.319 1977 0.224 0.285 1978 0.243 0.262 1979 0.704 0.459 1980 0.332 0.273 1981 0.240 0.269 1982 0.328 0.410 1983 0.596 0.326 1984 0.296 0.375 1985 0.405 0.411 1986 0.905 0.797 1987 0.397 0.533 1989 0.300 0.307 1990 0.273 0.280 1991 0.292 0.281 1992 0.244 0.309 1993 0.242 0.261 1994 0.209 0.281 1995 0.295 0.326 1998 0.206 0.382	1969	1.147	0.631
1972 0.288 0.470 1973 0.247 0.357 1974 0.688 0.438 1975 0.303 0.351 1976 0.257 0.319 1977 0.224 0.285 1978 0.243 0.262 1979 0.704 0.459 1980 0.332 0.273 1981 0.240 0.269 1982 0.328 0.410 1983 0.596 0.326 1984 0.296 0.375 1985 0.405 0.411 1986 0.905 0.797 1987 0.397 0.533 1988 0.239 0.292 1989 0.300 0.307 1990 0.273 0.280 1991 0.292 0.281 1992 0.244 0.309 1993 0.242 0.261 1994 0.209 0.281 1995 0.295 0.326 1998 0.206 0.382	1970		
1973 0.247 0.357 1974 0.688 0.438 1975 0.303 0.351 1976 0.257 0.319 1977 0.224 0.285 1978 0.243 0.262 1979 0.704 0.459 1980 0.332 0.273 1981 0.240 0.269 1982 0.328 0.410 1983 0.596 0.326 1984 0.296 0.375 1985 0.405 0.411 1986 0.905 0.797 1987 0.397 0.533 1988 0.239 0.292 1989 0.300 0.307 1990 0.273 0.280 1991 0.292 0.281 1992 0.244 0.309 1993 0.242 0.261 1994 0.209 0.281 1995 0.295 0.326 1997 1.108 0.934 1998 0.206 0.382			
1974 0.688 0.438 1975 0.303 0.351 1976 0.257 0.319 1977 0.224 0.285 1978 0.243 0.262 1979 0.704 0.459 1980 0.332 0.273 1981 0.240 0.269 1982 0.328 0.410 1983 0.596 0.326 1984 0.296 0.375 1985 0.405 0.411 1986 0.905 0.797 1987 0.397 0.533 1988 0.239 0.292 1989 0.300 0.307 1990 0.273 0.280 1991 0.292 0.281 1992 0.244 0.309 1993 0.242 0.261 1994 0.209 0.281 1995 0.295 0.326 1997 1.108 0.934 1998 0.206 0.382 1999 0.241 0.242			
1975 0.303 0.351 1976 0.257 0.319 1977 0.224 0.285 1978 0.243 0.262 1979 0.704 0.459 1980 0.332 0.273 1981 0.240 0.269 1982 0.328 0.410 1983 0.596 0.326 1984 0.296 0.375 1985 0.405 0.411 1986 0.905 0.797 1987 0.397 0.533 1988 0.239 0.292 1989 0.300 0.307 1990 0.273 0.280 1991 0.292 0.281 1992 0.244 0.309 1993 0.242 0.261 1994 0.209 0.281 1995 0.295 0.326 1997 1.108 0.934 1998 0.206 0.382 1999 0.241 0.242 2001 0.090 0.265			
1976 0.257 0.319 1977 0.224 0.285 1978 0.243 0.262 1979 0.704 0.459 1980 0.332 0.273 1981 0.240 0.269 1982 0.328 0.410 1983 0.596 0.326 1984 0.296 0.375 1985 0.405 0.411 1986 0.905 0.797 1987 0.397 0.533 1988 0.239 0.292 1989 0.300 0.307 1990 0.273 0.280 1991 0.292 0.281 1992 0.244 0.309 1993 0.242 0.261 1994 0.209 0.281 1995 0.295 0.326 1997 1.108 0.934 1998 0.206 0.382 1999 0.241 0.242 2001 0.090 0.265 2002 0.276 0.238			
1977 0.224 0.285 1978 0.243 0.262 1979 0.704 0.459 1980 0.332 0.273 1981 0.240 0.269 1982 0.328 0.410 1983 0.596 0.326 1984 0.296 0.375 1985 0.405 0.411 1986 0.905 0.797 1987 0.397 0.533 1988 0.239 0.292 1989 0.300 0.307 1990 0.273 0.280 1991 0.292 0.281 1992 0.244 0.309 1993 0.242 0.261 1994 0.209 0.281 1995 0.295 0.326 1997 1.108 0.934 1998 0.206 0.382 1999 0.241 0.242 2000 0.210 0.551 2001 0.090 0.265 2002 0.276 0.238			
1978 0.243 0.262 1979 0.704 0.459 1980 0.332 0.273 1981 0.240 0.269 1982 0.328 0.410 1983 0.596 0.326 1984 0.296 0.375 1985 0.405 0.411 1986 0.905 0.797 1987 0.397 0.533 1988 0.239 0.292 1989 0.300 0.307 1990 0.273 0.280 1991 0.292 0.281 1992 0.244 0.309 1993 0.242 0.261 1994 0.209 0.281 1995 0.295 0.326 1996 0.622 0.372 1997 1.108 0.934 1998 0.206 0.382 1999 0.241 0.242 2000 0.276 0.238 2001 0.090 0.265 2002 0.276 0.238			
1980 0.332 0.273 1981 0.240 0.269 1982 0.328 0.410 1983 0.596 0.326 1984 0.296 0.375 1985 0.405 0.411 1986 0.905 0.797 1987 0.397 0.533 1988 0.239 0.292 1989 0.300 0.307 1990 0.273 0.280 1991 0.292 0.281 1992 0.244 0.309 1993 0.242 0.261 1994 0.209 0.281 1995 0.295 0.326 1997 1.108 0.934 1998 0.206 0.382 1999 0.241 0.242 2000 0.210 0.551 2001 0.090 0.265 2002 0.276 0.238 2003 0.218 0.276 2004 0.356 0.274 2006 0.780 0.460			
1981 0.240 0.269 1982 0.328 0.410 1983 0.596 0.326 1984 0.296 0.375 1985 0.405 0.411 1986 0.905 0.797 1987 0.397 0.533 1988 0.239 0.292 1989 0.300 0.307 1990 0.273 0.280 1991 0.292 0.281 1992 0.244 0.309 1993 0.242 0.261 1994 0.209 0.281 1995 0.295 0.326 1996 0.622 0.372 1997 1.108 0.934 1998 0.206 0.382 1999 0.241 0.242 2000 0.210 0.551 2001 0.090 0.265 2002 0.276 0.238 2003 0.218 0.276 2004 0.356 0.540 2005 0.265 0.274	1979	0.704	0.459
1982 0.328 0.410 1983 0.596 0.326 1984 0.296 0.375 1985 0.405 0.411 1986 0.905 0.797 1987 0.397 0.533 1988 0.239 0.292 1989 0.300 0.307 1990 0.273 0.280 1991 0.292 0.281 1992 0.244 0.309 1993 0.242 0.261 1994 0.209 0.281 1995 0.295 0.326 1996 0.622 0.372 1997 1.108 0.934 1998 0.206 0.382 1999 0.241 0.242 2000 0.210 0.551 2001 0.090 0.265 2002 0.276 0.238 2003 0.218 0.276 2004 0.356 0.540 2005 0.265 0.274 2006 0.780 0.460			
1983 0.596 0.326 1984 0.296 0.375 1985 0.405 0.411 1986 0.905 0.797 1987 0.397 0.533 1988 0.239 0.292 1989 0.300 0.307 1990 0.273 0.280 1991 0.292 0.281 1992 0.244 0.309 1993 0.242 0.261 1994 0.209 0.281 1995 0.295 0.326 1996 0.622 0.372 1997 1.108 0.934 1998 0.206 0.382 1999 0.241 0.242 2000 0.210 0.551 2001 0.090 0.265 2002 0.276 0.238 2003 0.218 0.276 2004 0.356 0.540 2005 0.265 0.274 2006 0.780 0.460 2007 0.622 0.388			
1984 0.296 0.375 1985 0.405 0.411 1986 0.905 0.797 1987 0.397 0.533 1988 0.239 0.292 1989 0.300 0.307 1990 0.273 0.280 1991 0.292 0.281 1992 0.244 0.309 1993 0.242 0.261 1994 0.209 0.281 1995 0.295 0.326 1996 0.622 0.372 1997 1.108 0.934 1998 0.206 0.382 1999 0.241 0.242 2000 0.210 0.551 2001 0.090 0.265 2002 0.276 0.238 2003 0.218 0.276 2004 0.356 0.540 2005 0.265 0.274 2006 0.780 0.460 2007 0.622 0.388 2008 0.805 0.768 <td></td> <td></td> <td></td>			
1985 0.405 0.411 1986 0.905 0.797 1987 0.397 0.533 1988 0.239 0.292 1989 0.300 0.307 1990 0.273 0.280 1991 0.292 0.281 1992 0.244 0.309 1993 0.242 0.261 1994 0.209 0.281 1995 0.295 0.326 1996 0.622 0.372 1997 1.108 0.934 1998 0.206 0.382 1999 0.241 0.242 2000 0.210 0.551 2001 0.090 0.265 2002 0.276 0.238 2003 0.218 0.276 2004 0.356 0.540 2005 0.265 0.274 2006 0.780 0.460 2007 0.622 0.388 2008 0.805 0.768			
1986 0.905 0.797 1987 0.397 0.533 1988 0.239 0.292 1989 0.300 0.307 1990 0.273 0.280 1991 0.292 0.281 1992 0.244 0.309 1993 0.242 0.261 1994 0.209 0.281 1995 0.295 0.326 1996 0.622 0.372 1997 1.108 0.934 1998 0.206 0.382 1999 0.241 0.242 2000 0.210 0.551 2001 0.090 0.265 2002 0.276 0.238 2003 0.218 0.276 2004 0.356 0.540 2005 0.265 0.274 2006 0.780 0.460 2007 0.622 0.388 2008 0.805 0.768			
1987 0.397 0.533 1988 0.239 0.292 1989 0.300 0.307 1990 0.273 0.280 1991 0.292 0.281 1992 0.244 0.309 1993 0.242 0.261 1994 0.209 0.281 1995 0.295 0.326 1996 0.622 0.372 1997 1.108 0.934 1998 0.206 0.382 1999 0.241 0.242 2000 0.210 0.551 2001 0.090 0.265 2002 0.276 0.238 2003 0.218 0.276 2004 0.356 0.540 2005 0.265 0.274 2006 0.780 0.460 2007 0.622 0.388 2008 0.805 0.768			
1988 0.239 0.292 1989 0.300 0.307 1990 0.273 0.280 1991 0.292 0.281 1992 0.244 0.309 1993 0.242 0.261 1994 0.209 0.281 1995 0.295 0.326 1996 0.622 0.372 1997 1.108 0.934 1998 0.206 0.382 1999 0.241 0.242 2000 0.210 0.551 2001 0.090 0.265 2002 0.276 0.238 2003 0.218 0.276 2004 0.356 0.540 2005 0.265 0.274 2006 0.780 0.460 2007 0.622 0.388 2008 0.805 0.768			
1989 0.300 0.307 1990 0.273 0.280 1991 0.292 0.281 1992 0.244 0.309 1993 0.242 0.261 1994 0.209 0.281 1995 0.295 0.326 1996 0.622 0.372 1997 1.108 0.934 1998 0.206 0.382 1999 0.241 0.242 2000 0.210 0.551 2001 0.090 0.265 2002 0.276 0.238 2003 0.218 0.276 2004 0.356 0.540 2005 0.265 0.274 2006 0.780 0.460 2007 0.622 0.388 2008 0.805 0.768			
1991 0.292 0.281 1992 0.244 0.309 1993 0.242 0.261 1994 0.209 0.281 1995 0.295 0.326 1996 0.622 0.372 1997 1.108 0.934 1998 0.206 0.382 1999 0.241 0.242 2000 0.210 0.551 2001 0.090 0.265 2002 0.276 0.238 2003 0.218 0.276 2004 0.356 0.540 2005 0.265 0.274 2006 0.780 0.460 2007 0.622 0.388 2008 0.805 0.768	1989	0.300	
1992 0.244 0.309 1993 0.242 0.261 1994 0.209 0.281 1995 0.295 0.326 1996 0.622 0.372 1997 1.108 0.934 1998 0.206 0.382 1999 0.241 0.242 2000 0.210 0.551 2001 0.090 0.265 2002 0.276 0.238 2003 0.218 0.276 2004 0.356 0.540 2005 0.265 0.274 2006 0.780 0.460 2007 0.622 0.388 2008 0.805 0.768			
1993 0.242 0.261 1994 0.209 0.281 1995 0.295 0.326 1996 0.622 0.372 1997 1.108 0.934 1998 0.206 0.382 1999 0.241 0.242 2000 0.210 0.551 2001 0.090 0.265 2002 0.276 0.238 2003 0.218 0.276 2004 0.356 0.540 2005 0.265 0.274 2006 0.780 0.460 2007 0.622 0.388 2008 0.805 0.768			
1994 0.209 0.281 1995 0.295 0.326 1996 0.622 0.372 1997 1.108 0.934 1998 0.206 0.382 1999 0.241 0.242 2000 0.210 0.551 2001 0.090 0.265 2002 0.276 0.238 2003 0.218 0.276 2004 0.356 0.540 2005 0.265 0.274 2006 0.780 0.460 2007 0.622 0.388 2008 0.805 0.768			
1995 0.295 0.326 1996 0.622 0.372 1997 1.108 0.934 1998 0.206 0.382 1999 0.241 0.242 2000 0.210 0.551 2001 0.090 0.265 2002 0.276 0.238 2003 0.218 0.276 2004 0.356 0.540 2005 0.265 0.274 2006 0.780 0.460 2007 0.622 0.388 2008 0.805 0.768			
1996 0.622 0.372 1997 1.108 0.934 1998 0.206 0.382 1999 0.241 0.242 2000 0.210 0.551 2001 0.090 0.265 2002 0.276 0.238 2003 0.218 0.276 2004 0.356 0.540 2005 0.265 0.274 2006 0.780 0.460 2007 0.622 0.388 2008 0.805 0.768			
1997 1.108 0.934 1998 0.206 0.382 1999 0.241 0.242 2000 0.210 0.551 2001 0.090 0.265 2002 0.276 0.238 2003 0.218 0.276 2004 0.356 0.540 2005 0.265 0.274 2006 0.780 0.460 2007 0.622 0.388 2008 0.805 0.768			
1998 0.206 0.382 1999 0.241 0.242 2000 0.210 0.551 2001 0.090 0.265 2002 0.276 0.238 2003 0.218 0.276 2004 0.356 0.540 2005 0.265 0.274 2006 0.780 0.460 2007 0.622 0.388 2008 0.805 0.768			
2000 0.210 0.551 2001 0.090 0.265 2002 0.276 0.238 2003 0.218 0.276 2004 0.356 0.540 2005 0.265 0.274 2006 0.780 0.460 2007 0.622 0.388 2008 0.805 0.768			
2001 0.090 0.265 2002 0.276 0.238 2003 0.218 0.276 2004 0.356 0.540 2005 0.265 0.274 2006 0.780 0.460 2007 0.622 0.388 2008 0.805 0.768	1999	0.241	
2002 0.276 0.238 2003 0.218 0.276 2004 0.356 0.540 2005 0.265 0.274 2006 0.780 0.460 2007 0.622 0.388 2008 0.805 0.768	2000		
2003 0.218 0.276 2004 0.356 0.540 2005 0.265 0.274 2006 0.780 0.460 2007 0.622 0.388 2008 0.805 0.768			
2004 0.356 0.540 2005 0.265 0.274 2006 0.780 0.460 2007 0.622 0.388 2008 0.805 0.768			
2005 0.265 0.274 2006 0.780 0.460 2007 0.622 0.388 2008 0.805 0.768			
2006 0.780 0.460 2007 0.622 0.388 2008 0.805 0.768			
2007 0.622 0.388 2008 0.805 0.768			
2008 0.805 0.768			
		0.246	0.300

Stream Protection Duration

Ranked Annual Peaks for Predeveloped and Mitigated. POC #1

Rank Predeveloped Mitigated

1 1.4294 0.9335



2 3 4 5 6 7	1.3157 1.1762 1.1469 1.1075 0.9049 0.8048	0.8578 0.7972 0.7681 0.6511 0.6310 0.5680
8 9 10 11 12 13 14	0.7796 0.7044 0.6884 0.6225 0.6220 0.5961 0.5834	0.5514 0.5400 0.5331 0.4909 0.4696 0.4602 0.4587
15 16 17 18 19 20 21	0.4872 0.4427 0.4368 0.4292 0.4116 0.4097 0.4053 0.3969	0.4381 0.4195 0.4105 0.4097 0.3879 0.3842 0.3834 0.3818
22 23 24 25 26 27 28 29	0.3969 0.3809 0.3618 0.3577 0.3564 0.3550 0.3414 0.3322	0.3616 0.3751 0.3725 0.3657 0.3612 0.3572 0.3530 0.3513
30 31 32 33 34 35 36	0.3280 0.3180 0.3074 0.3033 0.2995 0.2958	0.3313 0.3420 0.3413 0.3399 0.3312 0.3259 0.3258 0.3228
37 38 39 40 41 42 43	0.2933 0.2918 0.2884 0.2864 0.2761 0.2727 0.2647 0.2567	0.3226 0.3194 0.3150 0.3093 0.3092 0.3071 0.2998 0.2920
43 44 45 46 47 48 49 50	0.2556 0.2551 0.2472 0.2456 0.2444 0.2429 0.2420	0.2920 0.2847 0.2810 0.2808 0.2805 0.2793 0.2765 0.2762
51 52 53 54 55	0.2420 0.2406 0.2397 0.2387 0.2277 0.2240 0.2179	0.2762 0.2737 0.2729 0.2693 0.2648 0.2620 0.2608



57	0.2101	0.2533
58	0.2088	0.2497
59	0.2059	0.2466
60	0.1814	0.2417
61	0.0900	0.2384

Stream Protection Duration POC #1
The Facility PASSED

The Facility PASSED.

Flow(cfs)	Predev	Mit Perd	centage	Pass/Fail
0.1757	11691	10354	88	Pass
0.1872	9432	7356	77	Pass
0.1986	7732	5711	73	Pass
0.2100	6192	4421	71	Pass
0.2214	5058	3542	70	Pass
0.2328	4139	2883	69	Pass
0.2443	3320	2284	68	Pass
0.2557	2763	1846	66	Pass
0.2671	2295	1485	64	Pass
0.2785	1939	1306	67	Pass
0.2900	1672	1166	69	Pass
0.3014	1444	1064	73	Pass
0.3128	1243	989	79	Pass
0.3242	1071	900	84	Pass
0.3356	943	834	88	Pass
0.3471	846	781	92	Pass
0.3585	759	731	96	Pass
0.3699	693	690	99	Pass
0.3813	636	642	100	Pass
0.3927	593	610	102	Pass
0.4042	546	573	104	Pass
0.4156	517	551	106	Pass
0.4270	490	520	106	Pass
0.4384	462	496	107	Pass
0.4498	444	477	107	Pass
0.4613	424	449	105	Pass
0.4727	396	419	105	Pass
0.4841	358	393	109	Pass
0.4955	341	374	109	Pass
0.5069	325	357	109	Pass
0.5184	311	336	108	Pass
0.5298	296	318	107	Pass
0.5412	283	300	106	Pass
0.5526	274	288	105	Pass
0.5640	263	278	105	Pass
0.5755	253	265	104	Pass
0.5869	245	249	101	Pass
0.5983	236	233	98	Pass
0.6097	226	219	96	Pass
0.6211	210	204	97	Pass
0.6326	201	187	93	Pass



0.6440	185	173	93	Pass
0.6554	173	158	91	Pass
0.6668	162	145	89	Pass
0.6782	157	128	81	Pass
0.6897	145	109	75	Pass
0.7011	130	95	73	Pass
0.7125	119	83	69	Pass
0.7239	109	70	64	Pass
0.7353	94	60	63	Pass
0.7468	80	52	65	Pass
0.7582	72	40	55	Pass
0.7696	62	31	50	Pass
0.7810	53	26	49	Pass
0.7924	39	22	56	Pass
0.8039	27	16	59	Pass
0.8153	22	13	59	Pass
0.8267	18	10	55	Pass
0.8381	15	7	46	Pass
0.8495	10	3	30	Pass
0.8610	10	2	20	Pass
0.8724	9	2	22	Pass
0.8838	9	2	22	Pass
0.8952	8	1	12	Pass
0.9066	7	1	14	Pass
0.9181	7	1		
			14	Pass
0.9295	7	1	14	Pass
0.9409	7	0	0	Pass
0.9523	7	0	0	Pass
0.9637	7	0	0	Pass
0.9752	7	0	0	Pass
0.9866	6	0	0	Pass
0.9980	6	0	0	Pass
1.0094	6	0	0	Pass
1.0209	6	0	0	Pass
1.0323	5	0	0	Pass
1.0437	5	0	0	Pass
1.0551	5	0	0	
				Pass
1.0665	5	0	0	Pass
1.0780	5	0	0	Pass
1.0894	5	0	0	Pass
1.1008	5	0	0	Pass
1.1122	4	0	0	Pass
1.1236	4	0	0	Pass
1.1351	4	0	0	Pass
1.1465	4	0	0	Pass
1.1579	3	0	0	Pass
1.1693	3	0	0	Pass
1.1807	2	0	0	
	2			Pass
1.1922		0	0	Pass
1.2036	2	0	0	Pass
1.2150	2	0	0	Pass
1.2264	2	0	0	Pass
1.2378	2	0	0	Pass
1.2493	2	0	0	Pass
1.2607	2	0	0	Pass



1.2721	2	0	0	Pass
1.2835	2	0	0	Pass
1.2949	2	0	0	Pass
1.3064	2	0	0	Pass

Water Quality BMP Flow and Volume for POC #1 On-line facility volume: 0 acre-feet On-line facility target flow: 0 cfs.

Adjusted for 15 min: 0 cfs.

Off-line facility target flow: 0 cfs.

Adjusted for 15 min: 0 cfs.

LID Report

LID Techniq	ue	Used for	Total Volume	Volume	Infiltration	Cumulative
Percent	Water Quality	Percent	Comment			
		Treatment?	Needs	Through	Volume	Volume
Volume		Water Quality				
			Treatment	Facility	(ac-ft.)	Infiltration
Infiltrated		Treated				
			(ac-ft)	(ac-ft)		Credit
Vault 1 PO	C	N	931.22			N
0.00						
Total Volum	e Infiltrated		931.22	0.00	0.00	
0.00	0.00	0%	No Treat. Credi	t		
Compliance	with LID Standa	rd 8				
Duration An	alysis Result =	Failed				

Perlnd and Implnd Changes

No changes have been made.

This program and accompanying documentation are provided 'as-is' without warranty of any kind. The entire risk regarding the performance and results of this program is assumed by End User. Clear Creek Solutions Inc. and the governmental licensee or sublicensees disclaim all warranties, either expressed or implied, including but not limited to implied warranties of program and accompanying documentation. In no event shall Clear Creek Solutions Inc. be liable for any damages whatsoever (including without limitation to damages for loss of business profits, loss of business information, business interruption, and the like) arising out of the use of, or inability to use this program even if Clear Creek Solutions Inc. or their authorized representatives have been advised of the possibility of such damages. Software Copyright © by: Clear Creek Solutions, Inc. 2005-2023; All Rights Reserved.



WWHM2012 PROJECT REPORT

Project Name: Brodie - Onsite Perkfilter

Site Name: Brodie
Site Address:

City : Marysville
Report Date: 1/25/2023
Gage : Everett
Data Start : 1948/10/03

Data Start: 1948/10/01 Data End: 2009/09/30 Precip Scale: 1.20

Version Date: 2021/08/18

Version : 4.2.18

Low Flow Threshold for POC 1: 50 Percent of the 2 Year

High Flow Threshold for POC 1: 50 year

PREDEVELOPED LAND USE

Name : Onsite
Bypass: No

GroundWater: No

 Pervious Land Use
 acre

 C, Forest, Mod
 1.31

 C, Forest, Steep
 5.77

Pervious Total 7.08

Impervious Land Use acre

Impervious Total 0

Basin Total 7.08

Element Flows To:

Surface Interflow Groundwater

MITIGATED LAND USE

Name : Onsite





Bypass: No

GroundWater: No

Pervious Land Use acre
C, Pasture, Flat 1.88

Pervious Total 1.88

 Impervious Land Use
 acre

 ROADS FLAT
 1.26

 ROOF TOPS FLAT
 2.43

 DRIVEWAYS FLAT
 0.4

 SIDEWALKS FLAT
 0.46

Impervious Total 4.55

Basin Total 6.43

Element Flows To:

Surface Interflow Groundwater

Vault 1 Vault 1

Name : Vault 1
Width : 169 ft.
Length : 60 ft.
Depth: 9 ft.
Discharge Structure

Riser Height: 8 ft.
Riser Diameter: 12 in.

Orifice 1 Diameter: 1.78125 in. Elevation: 0 ft. Orifice 2 Diameter: 1.75 in. Elevation: 3.9 ft. Orifice 3 Diameter: 2.5 in. Elevation: 4.45 ft.

Element Flows To:

Outlet 1 Outlet 2

ANALYSIS RESULTS

Stream Protection Duration

Predeveloped Landuse Totals for POC #1

Total Pervious Area:7.08 Total Impervious Area:0



Mitigated Landuse Totals for POC #1

Total Pervious Area:1.88
Total Impervious Area:4.55

Flow Frequency Return Periods for Predeveloped. POC #1

Return Period	Flow(cfs)
2 year	0.351495
5 year	0.573062
10 year	0.759995
25 year	1.048689
50 year	1.306358
100 year	1.604527

Flow Frequency Return Periods for Mitigated. POC #1

Return Period	Flow(cfs)
2 year	0.178745
5 year	0.264903
10 year	0.336796
25 year	0.447111
50 year	0.545232
100 year	0.65865



WWHM2012 PROJECT REPORT

Project Name: Brodie - Frontage Modular Wetland

Site Name: Site Address: City :

Report Date: 9/23/2022
Gage : Everett

Data Start: 1948/10/01 Data End: 2009/09/30 Precip Scale: 1.20

Version Date: 2021/08/18

Version : 4.2.18

Low Flow Threshold for POC 1 : 50 Percent of the 2 Year

High Flow Threshold for POC 1: 50 year

PREDEVELOPED LAND USE

Name : Frontage Bypass Basin

Bypass: No

GroundWater: No

Perv	ious L	and	Use	acre
C,	Pastur	e, E	'lat	.2

Pervious Total 0.2

Impervious Land Use	acre
ROADS FLAT	0.28
SIDEWALKS FLAT	0.17

Impervious Total 0.45

Basin Total 0.65

Element Flows To:

Surface Interflow Groundwater

MITIGATED LAND USE

Name : Frontage Bypass Basin

Bypass: No



GroundWater: No

Pervious Land Use acre
C, Pasture, Flat .2

Pervious Total 0.2

Impervious Land UseacreROADS FLAT0.28SIDEWALKS FLAT0.17

Impervious Total 0.45

Basin Total 0.65

Element Flows To:

Surface Interflow Groundwater

ANALYSIS RESULTS

Stream Protection Duration

Predeveloped Landuse Totals for POC #1

Total Pervious Area:0.2 Total Impervious Area:0.45

Mitigated Landuse Totals for POC #1

Total Pervious Area:0.2 Total Impervious Area:0.45

Flow Frequency Return Periods for Predeveloped. POC #1

Return Period	Flow(cfs)
2 year	0.246242
5 year	0.335987
10 year	0.402043
25 year	0.493371
50 year	0.567328
100 year	0.646543

Flow Frequency Return Periods for Mitigated. POC #1

Return Period	Flow(cfs)
2 year	0.246242
5 year	0.335987
10 year	0.402043
25 year	0.493371
50 year	0.567328
100 year	0.646543

Water Quality BMP Flow and Volume for POC #1 On-line facility volume: 0.058 acre-feet On-line facility target flow: 0.084 cfs.



Adjusted for 15 min: 0.084 cfs.
Off-line facility target flow: 0.0476 cfs.

Adjusted for 15 min: 0.0476 cfs.

Software Copyright © by : Clear Creek Solutions, Inc. 2005-2022; All Rights Reserved.



SECTION 5: CONVEYANCE DESIGN

The stormwater conveyance system is comprised of a network of open/closed grate catch basins, buried pipe, a concrete detention vault and a Perkfilter water quality vault, and the discharge to the existing wetland. Catch basins have been located such that each section of storm drainage pipe may adequately convey associated tributary area flows. All storm pipe located within the proposed private road was sized at the minimum diameter in accordance with the conveyance analysis.

The conveyance system was designed for the 100-year, 24-hour storm event, using the Rational Method with Everett IDF Tables. The Uniform Flow Method (Manning's Equation) was utilized to ensure that during the 100-year, 24-hour storm event, no catch basin structures would be overtopping. Conveyance analysis for the drainage system was completed using StormShed3G. See Appendix 5 for full StormShed output data as well as a visual representation of contributing conveyance basins.

The following catch basin summary table demonstrates that no catch basin structures overtop for the detention tributary drainage lines in the 100-year design storm event:



	3.00	ili Dialli CUI	nveyance Analysis	
CB #	Rim	HGL	Distance to Overtopping (ft)	Pipe Dia (in)
CB4	420.93	412.54	8.39	12
CB5	415.05	412.95	2.10	12
CB6	416.28	413.54	2.74	12
CB7	418.73	409.05	9.68	24
CB8	418.74	409.25	9.49	18
CB9	415.05	409.33	5.72	18
CB10	411.41	409.44	1.97	18
CB11	411.65	409.44	2.21	12
CB12	409.53	409.40	0.13	18
CB13	409.45	409.42	0.03	12
CB14	416.82	413.64	3.18	12
CB15	419.23	415.54	3.69	12
CB16	427.67	424.39	3.28	12
CB17	436.13	433.19	2.94	12
CB18	437.05	433.40	3.65	12
CB19	427.27	424.11	3.16	12
CB20	432.00	427.38	4.62	12
CB21	425.31	422.34	2.97	12
CB22	426.57	423.58	2.99	12
CB23	426.90	423.46	3.44	12
CB24	429.04	425.79	3.25	12
CB25	429.06	425.79	3.27	12
CB26	436.06	432.58	3.48	12
CB27	436.89	433.78	3.11	12
CB28	446.50	443.43		12
CB29	445.88	443.50	3.07	12
CB30	447.32	443.87	2.38	
CB30	401.92	397.64	3.45	12
CB32	401.92	398.78	4.28 5.10	12 12
CB33	400.26	399.11	1.15	12
CB35	403.87	402.55	1.32	12
CB36	404.93	403.80	1.13	12
CB37	405.42	403.81	1.61	12



Vault Discharge Line

A conveyance capacity calculation was performed using Manning's Equation on the shallowest pipe slope (CB-2 to CB-1) within the detention discharge line to verify pipe capacity in the 100-year unmitigated storm event. A summary evaluation of pipe capacity, offered below, demonstrates compliance in an overtopping condition where the full 100-year peak flow is conveyed through the discharge line. The calculations associated with this evaluation can be found in Appendix 5. CB-2 to CB-1:

100-Year Peak Flow Rate: 6.508 cfs (WWHM2012 - 701 Series)

Pipe Diameter: 18" Minimum Slope: 1.00% Pipe Flow Depth: 100% Pipe Flow Capacity: 8.26 cfs

Evaluation: System Adequate

Job No.: C22-177





Appendix 5: Conveyance Analysis

- 1. StormShed3G Output Data
- 2. Manning's Analysis: Vault Discharge

Appended on: Wednesday, October 12, 2022 10:17:34 AM

ROUTEHYD [] THRU [Brodie] USING [100 yr] AND [Everett] NOTZERO RELATIVE RATIONAL

Rational Method analysis

Reach ID	Area (ac)	TC (min)	i (in/hr)	Flow (cfs)	Full Q (cfs)	Full ratio	nDepth (ft)	Size	nVel (ft/s)	fVel (ft/s)	CArea
SD40	0.07	0.00	3.9213	0.2196	6.8262	0.0322	0.1229	12 in Diam	3.9712	8.6914	B37
SD39	0.19	0.1175	35.3149	5.05	3.6128	1.3978	1.00	12 in Diam	6.4299	4.60	B36
SD38	0.56	5.00	3.9213	1.4548	7.429	0.1958	0.3001	12 in Diam	7.3381	9.4589	B35
SD37	0.82	5.3748	3.7587	2.1688	3.636	0.5965	0.5564	12 in Diam	4.83	4.6295	B34
SD36	0.84	5.8613	3.5726	2.1257	3.7271	0.5703	0.5411	12 in Diam	4.9011	4.7455	В33
SD34	0.84	5.9395	3.545	2.1093	15.6003	0.1352	0.2483	12 in Diam	13.8691	19.8629	

HGL Analysis

From Node	To Node	HG El (ft)	App (ft)	Bend (ft)	Junct Loss (ft)	Adjusted HG El (ft)	Max El (ft)					
No approach	No approach losses at node CB33 because inverts and/or crowns are offset.											
CB32	CB31	397.6346		0.0030		397.6375	401.9200					
CB33	CB32	398.3026		0.4735		398.7762	403.8800					
CB34	CB33	399.1672	0.0533	0.0002		399.1142	400.2600					
CB35	CB34	402.2091		0.3362		402.5453	403.8700					
CB36	CB35	403.8040	0.0012	0.0006		403.8034	404.9300					
CB37	CB36	403.8054				403.8054	405.4200					

Conduit Notes

Reach	HW Depth (ft)	HW/D ratio	Q (cfs)	TW Depth (ft)	Dc (ft)	Dn (ft)	Comment
SD34	0.8946	0.8946	2.11	0.6206	0.6206	0.2483	SuperCrit flow, Inlet end controls
SD36	0.9426	0.9426	2.13	0.6230	0.6230	0.5411	SuperCrit flow, Inlet end controls

SD37	1.80	073	1.8073	2.17	1.416	62	0.629	93 0.	5564	Outlet	Contr	ol	
SD38	0.72	291	0.7291	1.45	1.054	1.0542 0.5		11 0.	30001		SuperCrit flow, Inlet end controls		
SD39	2.32	240	2.3240	5.05	1.065	1.0653 0.9		9195 >D		Outlet Control			
SD40	2.0′	754	2.0754	0.22	2.073	34	0.192	22 0.	1229	Outlet	Contr	ol	
Reach ID	Area (ac)	TC (min)	i (in/hr)	Flow (cfs)	Full Q (cfs)	Full ratio	- 11	Dept (ft)	h	7A II	ıVel (ft/s)	fVel (ft/s)	CArea
SD20	0.52	11.526	2.4037	0.7716	7.4182	0.104	4 0	.2172	2 12 Dia	11 6	.1316	9.4452	B18
SD19	1.04	11.607	2.3938	1.7546	24.3236	0.072	1 0	.1818	B 12 Dia		.9935	30.9697	B17
SD22	0.47	11.526	4 2.4037	0.6129	14.4022	0.042	6 0	.1408	B 12 Dia	11 9	.0969	18.3375	B20
SD21	0.74	11.605	1 2.3941	1.075	6.4243	0.167	0	.2763	3 12 Dia	II N	.0837	8.1797	B19
SD18	1.81	11.684	6 2.3846	2.8662	20.1719	0.142	1 0	.2543	3 12 Dia	II I X	3.2246	25.6836	B16
SD17	0.11	0.00	3.9213	0.3882	15.5608	0.024	9 0	.1091	l 12 Dia	II X	.3573	19.8127	B15
SD16	1.98	11.749	2.3768	3.1873	16.6968	0.190	9 0	.2962	2 12 Dia	แเก	5.3749	21.259	B14
SD15	0.46	13.251	6 2.215	0.6379	5.1601	0.123	6 0	.2375	5 12 Dia	11 4	.4663	6.5701	B13
SD14	2.52	13.356	1 2.2049	3.7196	15.2138	0.244	5 0	.5048	B 18 Dia	11 /	.1204	8.6092	B12
SD13	0.11	0.00	3.9213	0.3333	15.1259	0.022	2 0	.1026	5 12 Dia	11 /	.8496	19.2589	B11
SD12	2.73	13.445	2.1963	4.0895	20.036	0.204	1 0	.4598	3 18 Dia	in m 8.	.9016	11.3381	B10
SD11	2.77	13.564	9 2.1849	4.1317	15.2138	0.271	6).534	18 Dia	11 /	.3239	8.6092	В9
SD27	0.07	0.00	3.9213	0.1921	5.1601	0.037	2 0	.1317	7 12 Dia	11 3	.1424	6.5701	B25
SD26	0.14	0.1432	31.4515	3.0822	12.7654	0.241	5 0	.3341	1 Dia	11 1 3	.4048	16.2535	B24
SD25	0.64	11.085	1 2.4593	1.1239	5.1601	0.217	8 0	.3172	2 12 Dia	11 7	.2501	6.5701	B23
SD32	0.73	11.526	4 2.4037	1.1922	8.2562	0.144	4 0	.2562	2 12 Dia	11 /	.4996	10.5121	B30
SD31	0.87	11.606	2.394	1.422	5.1601	0.275	6 0	.3588	3 12 Dia	11 7	.6107	6.5701	B29
SD30	1.10	11.698	4 2.3829	1.8253	17.9792	0.101	5 0	.2148	3 12 Dia	11 1 4	.7389	22.8918	B28

SD29	0.03	0.00	3.9213	0.1059	13.3663	0.0079	0.063	12 in Diam	5.121	17.0185	B27
SD28	1.18	11.7957	2.3714	1.9706	16.5768	0.1189	0.2333	12 in Diam	14.1523	21.1062	B26
SD24	1.87	11.9017	2.359	3.128	11.1215	0.2813	0.3628	12 in Diam	12.1594	14.1603	B22
SD23	2.07	11.9442	2.3541	3.4793	19.726	0.1764	0.2839	12 in Diam	18.9549	25.1159	B21
SD10	5.24	13.731	2.1694	7.9833	32.7648	0.2437	0.6717	24 in Diam	8.6192	10.4293	В8
SD9	5.39	13.7813	2.1647	8.2282	32.7648	0.2511	0.6831	24 in Diam	8.6823	10.4293	В7

HGL Analysis

From Node	To Node	HG El (ft)	App (ft)	Bend (ft)	Junct Loss (ft)	Adjusted HG El (ft)	Max El (ft)
							409.00
CB7	VAULT IN 2	409.1455	0.1003	0.0015		409.0467	418.7300
CB8	CB7	409.1824	0.0849	0.1145	0.0418	409.2539	418.7400
CB9	CB8	409.4096	0.0832	0.0019		409.3283	415.0500
CB10	CB9	409.4743	0.0688	0.0299	0.0050	409.4404	411.4100
CB12	CB10	409.5457	0.2557	0.0729	0.0392	409.4021	409.5300
CB14	CB12	413.6142		0.0012	0.0221	413.6375	416.8200
CB16	CB14	424.3357		0.0229	0.0303	424.3889	427.6700
CB17	CB16	433.0012		0.1860		433.1872	436.1300
CB18	CB17	433.3996				433.3996	437.0500
CB19	CB16	424.4369	1.2850	0.9608		424.1127	427.2700
CB20	CB19	427.3799				427.3799	432.0000
CB15	CB14	415.5353				415.5353	419.2300
CB13	CB12	409.4186				409.4186	409.4500
CB11	CB10	409.4449				409.4449	411.6500
CB21	CB8	422.2453		0.0961		422.3414	425.3100
CB22	CB21	423.5033		0.0366	0.0362	423.5761	426.5700
CB23	CB22	423.6275	0.2391	0.0750		423.4634	426.9000
CB24	CB23	425.7908		0.0004		425.7912	429.0400
CB25	CB24	425.7927				425.7927	429.0600
CB26	CB22	432.4066		0.0111	0.1608	432.5785	436.0600
CB28	CB26	442.7932		0.6321		443.4253	446.5000

CB29	CB28	443.5099	0.0358	0.0298	 443.5039	445.8800
CB30	CB29	443.8726			 443.8726	447.3200
CB27	CB26	433.7848			 433.7848	436.8900

Conduit Notes

Reach	HW Depth (ft)	HW/D ratio	Q (cfs)	TW Depth (ft)	Dc (ft)	Dn (ft)	Comment
SD9	8.1455	4.0727	8.23	8.0000	1.0221	0.6831	Outlet Control
SD10	7.9024	3.9512	7.98	7.7667	1.0060	0.6717	Outlet Control
SD11	7.3696	4.9130	4.13	7.2139	0.7788	0.5340	Outlet Control
SD12	6.7043	4.4696	4.09	6.5583	0.7746	0.4598	Outlet Control
SD14	5.6657	3.7771	3.72	5.5604	0.7370	0.5048	Outlet Control
SD16	1.2942	1.2942	3.19	5.1421	0.7650	0.2962	SuperCrit flow, Inlet end controls
SD18	1.1657	1.1657	2.87	1.3175	0.7264	0.2543	SuperCrit flow, Inlet end controls
SD19	0.7212	0.7212	1.75	1.2189	0.5638	0.1818	SuperCrit flow, Inlet end controls
SD20	0.4996	0.4996	0.77	0.9072	0.3670	0.2172	SuperCrit flow, Inlet end controls
SD21	1.2664	1.2664	1.07	1.2189	0.4361	0.2763	Outlet Control
SD22	0.4099	0.4099	0.61	0.4927	0.3257	0.1408	SuperCrit flow, Inlet end controls
SD17	0.3053	0.3053	0.39	1.3175	0.2575	0.1091	SuperCrit flow, Inlet end controls
SD15	5.1586	5.1586	0.64	5.1421	0.3326	0.2375	Outlet Control
SD13	5.5649	5.5649	0.33	5.5604	0.2380	0.1026	Outlet Control
SD23	1.4153	1.4153	3.48	7.7139	0.7973	0.2839	SuperCrit flow, Inlet end controls
SD24	1.2333	1.2333	3.13	1.5114	0.7581	0.3628	SuperCrit flow, Inlet end controls
SD25	1.3575	1.3575	1.12	1.3061	0.4464	0.3172	Outlet Control
SD26	1.2208	1.2208	3.08	0.9134	0.7527	0.3341	SuperCrit flow, Inlet end controls
SD27	1.2227	1.2227	0.19	1.2212	0.1799	0.1317	Outlet Control
SD28	0.8466	0.8466	1.97	1.3061	0.5990	0.2333	SuperCrit flow, Inlet end controls
SD30	0.7932	0.7932	1.83	1.0185	0.5756	0.2148	SuperCrit flow, Inlet end controls
SD31	1.5099	1.5099	1.42	1.4253	0.5050	0.3588	Outlet Control

SD32	0.64	126	0.6426	1.19	1.19	39 0	.4603	0.2562	SuperC controls	rit flo	ow, Inlet e	end
SD29	0.14	148	0.1448	0.11	1.01	85 0	.1320	0.0630	SuperC controls		ow, Inlet e	end
Reach ID	Area (ac)	TC (min)	i (in/hr)	Flow (cfs)	Full Q (cfs)	Full ratio	nDep (ft)	11 51	70 II	Vel t/s)	fVel (ft/s)	CArea
SD8	0.27	5.00	3.9213	0.8431	11.6874	0.0721	0.18	IX II	in am 8.6	5458	14.8809	В6
SD7	0.47	5.0463	3.9002	1.4587	11.2306	0.1299	0.243	3 3 II	in am 9.8	3723	14.2992	В5
SD6	0.69	11.5264	2.4037	1.2235	16.0524	0.0762	0.18	らつ II	in am 12.0	0937	20.4385	B4

HGL Analysis

From Node	To Node	HG El (ft)	App (ft)	Bend (ft)	Junct Loss (ft)	Adjusted HG El (ft)	Max El (ft)
							409.00
CB4	VAULT IN 1	410.6172		1.9255		412.5426	420.9300
CB5	CB4	412.6373	1.1607	1.4768		412.9533	415.0500
CB6	CB5	413.5404				413.5404	416.2800

Conduit Notes

Reach	HW Depth (ft)	HW/D ratio	Q (cfs)	TW Depth (ft)	Dc (ft)	Dn (ft)	Comment
SD6	0.6172	0.6172	1.22	2.0000	0.4666	0.1865	SuperCrit flow, Inlet end controls
SD7	2.6373	2.6373	1.46	2.5426	0.5118	0.2433	Outlet Control
SD8	0.5104	0.5104	0.84	1.1533	0.3844	0.1818	SuperCrit flow, Inlet end controls

Node and Reach invert report

Licensed to: Debug License

Node and Reach invert report	
- 10 000 0000 0000 0000 0000 0000 0000	

Open Channel Flow Calculator For Circular Pipes

Land Development Consultants, Inc.

14201 NE 200th St. Ste. 100 Woodinville, WA 98072 Tel: (425) 806-1869 Fax: (425) 482-2893

Project Name: Brodie Plat

Description: Vault Outfall Conveyance

Project No.: C22-177


Date: 10/12/2022

Calc. By: RKF

Pipe Diameter (D) =	18	in
Pipe Slope (S) =	1.00	%

Flow Depth (y) = 1.00 ft

Mannings Coeff. (n) =	0.013	
Theta Angle (θ) =	3.82	rad
Wetted Area (A) =	1.25	ft ²
Wet. Perimeter (P) =	2.87	ft
Hydraulic Radius (R) =	0.44	ft
Top Width (T) =	1.41	ft
Flow Velocity =	6.60	fps

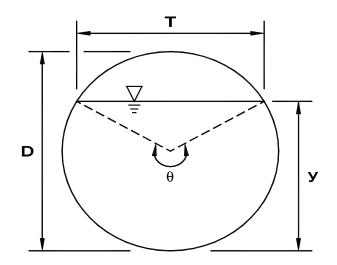

Formulas:

Theta Angle (
$$\theta$$
): If $y \ge r$: $\theta = 2\pi - 2a\cos(\frac{y-r}{r})$

where: r = Pipe Radius

If
$$y \le r$$
: $\theta = 2a \cos(\frac{r-y}{r})$

where: r = Pipe Radius

Wetted Area (A):
$$A = \frac{1}{8} (\theta - \sin \theta) d^2$$

Wetted Perimeter (P):
$$P = \frac{1}{2} \theta d$$

Hydraulic Radius (R):
$$R = \frac{A}{P}$$

Top Width (T):
$$T = \sin \left(\frac{\theta}{2}\right) d$$



SECTION 6: OPERATIONS AND MAINTENANCE MANUAL

The proposed storm drainage system consists of buried pipes, catch basins, a detention vault, and a perkfilter water quality treatment structure and a modular wetland water quality treatment structure. These facilities will require periodic maintenance and inspection. Inspection and maintenance procedures are contained on the following pages.

Maintenance	Defect or Problem	Condition When Maintenance is Needed	Results Expected When
Component	Beleat of Froblem	Condition When mannenance is needed	Maintenance is Performed
Structure	Sediment	Sediment exceeds 60% of the depth from the bottom of the catch basin to the invert of the lowest pipe into or out of the catch basin or is within 6 inches of the invert of the lowest pipe into or out of the catch basin.	Sump of catch basin contains no sediment.
	Trash and debris	Trash or debris of more than ½ cubic foot which is located immediately in front of the catch basin opening or is blocking capacity of the catch basin by more than 10%.	No Trash or debris blocking or potentially blocking entrance to catch basin.
		Trash or debris in the catch basin that exceeds ¹ / ₃ the depth from the bottom of basin to invert the lowest pipe into or out of the basin.	No trash or debris in the catch basin.
		Dead animals or vegetation that could generate odors that could cause complaints or dangerous gases (e.g., methane).	No dead animals or vegetation present within catch basin.
		Deposits of garbage exceeding 1 cubic foot in volume.	No condition present which would attract or support the breeding of insects or rodents.
	Damage to frame and/or top slab	Corner of frame extends more than ¾ inch past curb face into the street (If applicable).	Frame is even with curb.
		Top slab has holes larger than 2 square inches or cracks wider than ¼ inch.	Top slab is free of holes and cracks.
		Frame not sitting flush on top slab, i.e., separation of more than ¾ inch of the frame from the top slab.	Frame is sitting flush on top slab.
	Cracks in walls or bottom	Cracks wider than ½ inch and longer than 3 feet, any evidence of soil particles entering catch basin through cracks, or maintenance person judges that catch basin is unsound.	Catch basin is sealed and is structurally sound.
		Cracks wider than ½ inch and longer than 1 foot at the joint of any inlet/outlet pipe or any evidence of soil particles entering catch basin through cracks.	No cracks more than $^1/_4$ inch wide at the joint of inlet/outlet pipe.
	Settlement/ misalignment	Catch basin has settled more than 1 inch or has rotated more than 2 inches out of alignment.	Basin replaced or repaired to design standards.
	Damaged pipe joints	Cracks wider than ½-inch at the joint of the inlet/outlet pipes or any evidence of soil entering the catch basin at the joint of the inlet/outlet pipes.	No cracks more than ¼-inch wide at the joint of inlet/outlet pipes.
	Contaminants and pollution	Any evidence of contaminants or pollution such as oil, gasoline, concrete slurries or paint.	Materials removed and disposed of according to applicable regulations. Source control BMPs implemented if appropriate. No contaminants present other than a surface oil film.
Inlet/Outlet Pipe	Sediment accumulation	Sediment filling 20% or more of the pipe.	Inlet/outlet pipes clear of sediment.
	Trash and debris	Trash and debris accumulated in inlet/outlet pipes (includes floatables and non-floatables).	No trash or debris in pipes.
	Damaged	Cracks wider than ½-inch at the joint of the inlet/outlet pipes or any evidence of soil entering at the joints of the inlet/outlet pipes.	No cracks more than ¼-inch wide at the joint of the inlet/outlet pipe.

NO. 5 – CATCH BASINS AND MANHOLES					
Maintenance Component	Defect or Problem	Condition When Maintenance is Needed	Results Expected When Maintenance is Performed		
Metal Grates (Catch Basins)	Unsafe grate opening	Grate with opening wider than ⁷ / ₈ inch.	Grate opening meets design standards.		
	Trash and debris	Trash and debris that is blocking more than 20% of grate surface.	Grate free of trash and debris. footnote to guidelines for disposal		
	Damaged or missing	Grate missing or broken member(s) of the grate. Any open structure requires urgent maintenance.	Grate is in place and meets design standards.		
Manhole Cover/Lid	Cover/lid not in place	Cover/lid is missing or only partially in place. Any open structure requires urgent maintenance.	Cover/lid protects opening to structure.		
	Locking mechanism Not Working	Mechanism cannot be opened by one maintenance person with proper tools. Bolts cannot be seated. Self-locking cover/lid does not work.	Mechanism opens with proper tools.		
	Cover/lid difficult to Remove	One maintenance person cannot remove cover/lid after applying 80 lbs. of lift.	Cover/lid can be removed and reinstalled by one maintenance person.		

Maintenance Component	Defect or Problem	Conditions When Maintenance is Needed	Results Expected When Maintenance is Performed
Pipes	Sediment & debris accumulation	Accumulated sediment or debris that exceeds 20% of the diameter of the pipe.	Water flows freely through pipes.
	Vegetation/roots	Vegetation/roots that reduce free movement of water through pipes.	Water flows freely through pipes.
	Contaminants and pollution	Any evidence of contaminants or pollution such as oil, gasoline, concrete slurries or paint.	Materials removed and disposed of according to applicable regulations. Source control BMPs implemented if appropriate. No contaminants present other than a surface oil film.
	Damage to protective coating or corrosion	Protective coating is damaged; rust or corrosion is weakening the structural integrity of any part of pipe.	Pipe repaired or replaced.
	Damaged	Any dent that decreases the cross section area of pipe by more than 20% or is determined to have weakened structural integrity of the pipe.	Pipe repaired or replaced.
Ditches	Trash and debris	Trash and debris exceeds 1 cubic foot per 1,000 square feet of ditch and slopes.	Trash and debris cleared from ditches.
	Sediment accumulation	Accumulated sediment that exceeds 20% of the design depth.	Ditch cleaned/flushed of all sediment and debris so that it matches design.
	Noxious weeds	Any noxious or nuisance vegetation which may constitute a hazard to County personnel or the public.	Noxious and nuisance vegetation removed according to applicable regulations. No danger of noxious vegetation where County personnel or the public might normally be.
	Contaminants and pollution	Any evidence of contaminants or pollution such as oil, gasoline, concrete slurries or paint.	Materials removed and disposed of according to applicable regulations. Source control BMPs implemented if appropriate. No contaminants present other than a surface oil film.
	Vegetation	Vegetation that reduces free movement of water through ditches.	Water flows freely through ditches.
	Erosion damage to slopes	Any erosion observed on a ditch slope.	Slopes are not eroding.
	Rock lining out of place or missing (If Applicable)	One layer or less of rock exists above native soil area 5 square feet or more, any exposed native soil.	Replace rocks to design standards.





PERKFILTERTM

Inspection and Maintenance Guide





PerkFilter™ Media Filtration System

Description

The PerkFilter is a stormwater treatment device used to remove pollutants from urban runoff. Impervious surfaces and other urban and suburban landscapes generate a variety of contaminants that can enter stormwater and pollute downstream receiving waters. The PerkFilter is a media-filled cartridge filtration device designed to capture and retain sediment, gross solids, metals, nutrients, hydrocarbons, and trash and debris. As with any stormwater treatment system, the PerkFilter requires periodic maintenance to sustain optimum system performance.

Function

The PerkFilter is a water quality treatment system consisting of three chambers: an inlet chamber, a filter cartridge treatment chamber, and an outlet chamber (Figure 1). Stormwater runoff enters the inlet chamber through an inlet pipe, curb opening, or grated inlet. Gross solids are settled out, and floating trash and debris are trapped in the inlet chamber. Pretreated flow is then directed to the treatment chamber through an opening in the baffle wall between the inlet chamber and treatment chamber. The treatment chamber contains media-filled filter cartridges (Figure 2) that use physical and chemical processes to remove pollutants. During a storm event, runoff pools in the treatment chamber before passing radially through the cylindrical cartridges from the outside surface, through the media for treatment, and into the center of the cartridge. At the center of the cartridge is a center tube assembly designed to distribute the hydraulic load evenly across the surface of the filter cartridge and control the treatment flow rate. The center tube assembly discharges treated flow through the false floor and into the outlet chamber. A draindown feature built into each cartridge allows the treatment chamber to dewater between storm events.

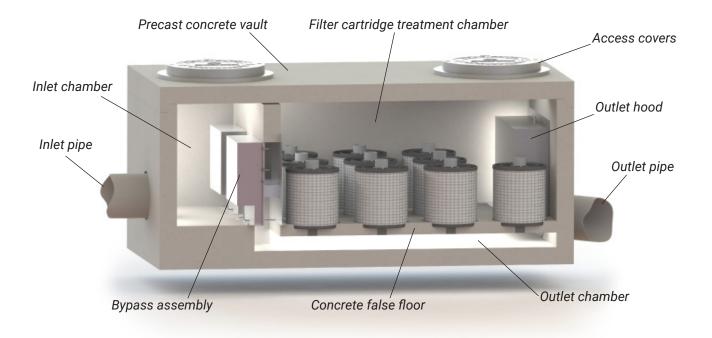


Figure 1. Schematic of the PerkFilter system.

All PerkFilter systems include a high-flow bypass assembly to divert flow exceeding the treatment capacity of the filter cartridges around the treatment chamber. The bypass assembly routes peak flow from the inlet chamber directly to the outlet chamber, bypassing the treatment chamber to prevent sediment and other captured pollutants from being scoured and re-entrained by high flow. Treated flow and bypass flow merge in the outlet chamber for discharge by a single outlet pipe.

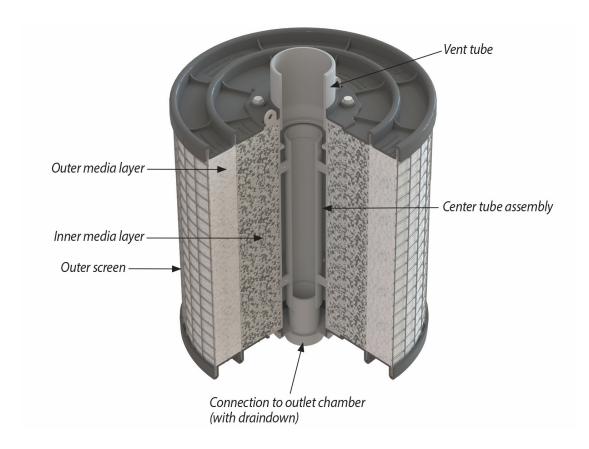


Figure 2. Schematic of PerkFilter cartridge.

Configuration

The PerkFilter structure may consist of a vault, manhole, or catch basin configuration. Catch basin units may be fabricated from concrete or steel. Internal components including the PerkFilter cartridges are manufactured from durable plastic and stainless steel components and hardware. All cartridges are 18 inches in diameter and are available in two heights: 12-inch and 18-inch. Cartridges may be used alone or may be stacked (Figure 3) to provide 24-inch and 30-inch combinations. The capacity of each cartridge or cartridge combination is dictated by the allowable operating rate of the media and the outer surface area of the cartridge. Thus, taller cartridges have greater treatment capacity than shorter cartridges, but they also require more hydraulic drop across the system. Cartridges may be filled with various media depending on the target pollutants and desired treatment rate, among other factors.

Access to an installed PerkFilter system is typically provided by ductile iron castings or hatch covers. The location and number of access appurtenances is dependent on the size and configuration of the system.

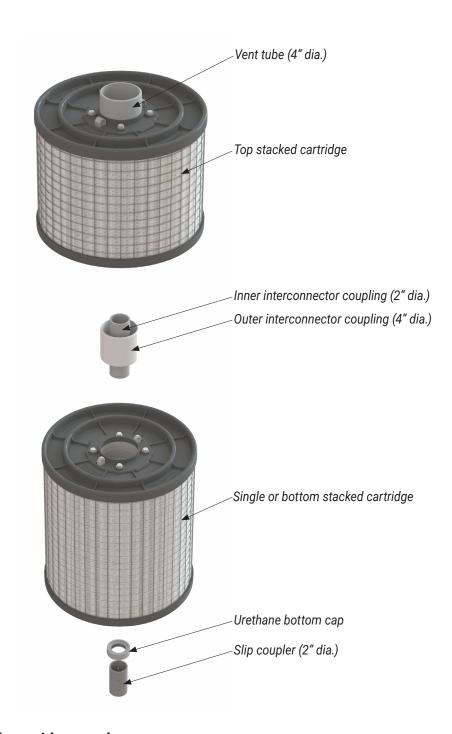


Figure 3. Schematic of stacked cartridges and connector components.

Maintenance Overview

State and local regulations require all stormwater management systems to be inspected on a periodic basis and maintained as necessary to ensure performance and protect downstream receiving waters. Maintenance prevents excessive pollutant buildup that can limit system performance by reducing the operating capacity and increasing the potential for scouring of pollutants during periods of high flow.

Inspection and Maintenance Frequency

The PerkFilter should be inspected on a periodic basis, typically twice per year, and maintained as required. Initially, inspections of a new system should be conducted more frequently to help establish an appropriate site-specific inspection frequency. The maintenance frequency will be driven by the amount of runoff and pollutant loading encountered by a given system. In most cases, the optimum maintenance interval will be one to three years. Inspection and maintenance activities should be performed only during dry weather periods.

Inspection Equipment

The following equipment is helpful when conducting PerkFilter inspections:

- Recording device (pen and paper form, voice recorder, iPad, etc.)
- Suitable clothing (appropriate footwear, gloves, hardhat, safety glasses, etc.)
- Traffic control equipment (cones, barricades, signage, flagging, etc.)
- · Socket and wrench for bolt-down access covers
- Manhole hook or pry bar
- Flashlight
- · Tape measure
- Measuring stick or sludge sampler
- Long-handled net (optional)

Inspection Procedures

PerkFilter inspections are visual and may be conducted from the ground surface without entering the unit. To complete an inspection, safety measures including traffic control should be deployed before the access covers are removed. Once the covers have been removed, the following items should be checked and recorded (see form provided at the end of this document) to determine whether maintenance is required:

- Inspect the internal components and note whether there are any broken or missing parts. In the unlikely
 event that internal parts are broken or missing, contact Oldcastle Infrastructure at (800) 579-8819 to
 determine appropriate corrective action.
- Note whether the inlet pipe is blocked or obstructed. The outlet pipe is covered by a removable outlet hood and cannot be observed without entering the unit.
- Observe, quantify and record the accumulation of floating trash and debris in the inlet chamber. The significance of accumulated floating trash and debris is a matter of judgment. A long-handled net may be used to retrieve the bulk of trash and debris at the time of inspection if full maintenance due to accumulation of floating oils or settled sediment is not yet warranted.

- Observe, quantify and record the accumulation of oils in the inlet chamber. The significance of accumulated floating oils is a matter of judgment. However, if there is evidence of an oil or fuel spill, immediate maintenance by appropriate certified personnel is warranted.
- Observe, quantify and record the average accumulation of sediment in the inlet chamber and treatment chamber. A calibrated dipstick, tape measure, or sludge sampler may be used to determine the amount of accumulated sediment in each chamber. The depth of sediment may be determined by calculating the difference between the measurement from the rim of the PerkFilter to the top of the accumulated sediment, and the measurement from the rim of the PerkFilter to the bottom of the PerkFilter structure. Finding the top of the accumulated sediment below standing water takes some practice and a light touch, but increased resistance as the measuring device is lowered toward the bottom of the unit indicates the top of the accumulated sediment.
- Finally, observe, quantify and record the amount of standing water in the treatment chamber around the cartridges. If standing water is present, do not include the depth of sediment that may have settled out below the standing water in the measurement.

Maintenance Triggers

Maintenance should be scheduled if any of the following conditions are identified during the inspection:

- Internal components are broken or missing.
- · Inlet piping is obstructed.
- The accumulation of floating trash and debris that cannot be retrieved with a net and/or oil in the inlet chamber is significant.
- There is more than 6" of accumulated sediment in the inlet chamber.
- There is more than 4" of accumulated sediment in the treatment chamber.
- There is more than 4" of standing water in the treatment chamber more than 24 hours after end of rain event
- A hazardous material release (e.g. automotive fluids) is observed or reported.
- The system has not been maintained for 3 years (wet climates) to 5 years (dry climates).

Maintenance Equipment

The following equipment is helpful when conducting PerkFilter maintenance:

- Suitable clothing (appropriate footwear, gloves, hardhat, safety glasses, etc.)
- Traffic control equipment (cones, barricades, signage, flagging, etc.)
- · Socket and wrench for bolt-down access covers
- Manhole hook or pry bar
- · Confined space entry equipment, if needed
- Flashlight
- Tape measure
- 9/16" socket and wrench to remove hold-down struts and filter cartridge tops
- · Replacement filter cartridges
- · Vacuum truck with water supply and water jet

Contact Oldcastle Infrastructure at (800) 579-8819 for replacement filter cartridges. A lead time of four weeks is recommended.

Maintenance Procedures

Maintenance should be conducted during dry weather when no flow is entering the system. Confined space entry is necessary to maintain vault and manhole PerkFilter configurations. Only personnel that are OSHA Confined Space Entry trained and certified may enter underground structures. Confined space entry is not required for catch basin PerkFilter configurations. Once safety measures such as traffic control are deployed, the access covers may be removed and the following activities may be conducted to complete maintenance:

- Remove floating trash, debris and oils from the water surface in the inlet chamber using the extension nozzle on the end of the boom hose of the vacuum truck. Continue using the vacuum truck to completely dewater the inlet chamber and evacuate all accumulated sediment from the inlet chamber. Some jetting may be required to fully remove sediment. The inlet chamber does not need to be refilled with water after maintenance is complete. The system will fill with water when the next storm event occurs.
- Remove the hold-down strut from each row of filter cartridges and then remove the top of each cartridge
 (the top is held on by four 9/16" bolts) and use the vacuum truck to evacuate the spent media. When
 empty, the spent cartridges may be easily lifted off their slip couplers and removed from the vault. The
 couplers may be left inserted into couplings cast into the false floor to prevent sediment and debris from
 being washed into the outlet chamber during washdown.
- Once all the spent cartridges have been removed from the structure, the vacuum truck may be used to
 evacuate all accumulated sediment from the treatment chamber. Some jetting may be required to fully
 remove sediment. Take care not to wash sediment and debris through the openings in the false floor and
 into the outlet chamber. All material removed from the PerkFilter during maintenance including the spent
 media must be disposed of in accordance with local, state, and/or federal regulations. In most cases,
 the material may be handled in the same manner as disposal of material removed from sumped catch
 basins or manholes.
- Place a fresh cartridge in each cartridge position using the existing slip couplers and urethane bottom
 caps. If the vault is equipped with stacked cartridges, the existing outer and inner interconnector couplers
 must be used between the stacked cartridges to provide hydraulic connection. Transfer the existing vent
 tubes from the spent cartridges to the fresh cartridges. Finally, refit the struts to hold the fresh cartridges
 in place.
- · Securely replace access covers, as appropriate.
- Make arrangements to return the empty spent cartridges to Oldcastle Infrastructure.

PerkFilter Inspection and Maintenance Log

Location						
Structure Configuration and Size: Vaultfeet xfeet Manholefeet diameter Catch Basinfeet xfeet	Inspection Date					
Number and Height of Cartridge Stacks: Counteach □12" □ 18" □ 24" □ 30"	Media Type: ZPC Perlite Other					
Condition of Internal Components	Notes:					
Good Damaged Missing						
Inlet or Outlet Blockage or Obstruction	Notes:					
☐ Yes ☐ No						
Floating Trash and Debris	Notes:					
Significant Not Significant						
Floating Oils	Notes:					
Significant Not Significant Spill						
Sediment Depth in Inlet Chamber	Notes:					
Inches of Sediment:						
Sediment Depth in Treatment Chamber	Notes:					
Inches of Sediment:						
Standing Water in Treatment Chamber	Notes:					
Inches of Standing Water:						
Maintenance Required						
Yes - Schedule Maintenance No - Inspect Again in Months						

PERKFILTERTM

OUR MARKETS


















Modular Wetlands® Linear Operation & Maintenance Manual





Maintenance Summary

- Remove Trash from Screening Device average maintenance interval is 6 to 12 months.
 - ° (5 minute average service time).
- Remove Sediment from Separation Chamber average maintenance interval is 12 to 24 months.
 - (10 minute average service time).
- Replace Cartridge Filter Media average maintenance interval 12 to 24 months.
 - ° (10-15 minute per cartridge average service time).
- Replace Drain Down Filter Media average maintenance interval is 12 to 24 months.
 - ° (5 minute average service time).
- Trim Vegetation average maintenance interval is 6 to 12 months.
 - O (Service time varies).

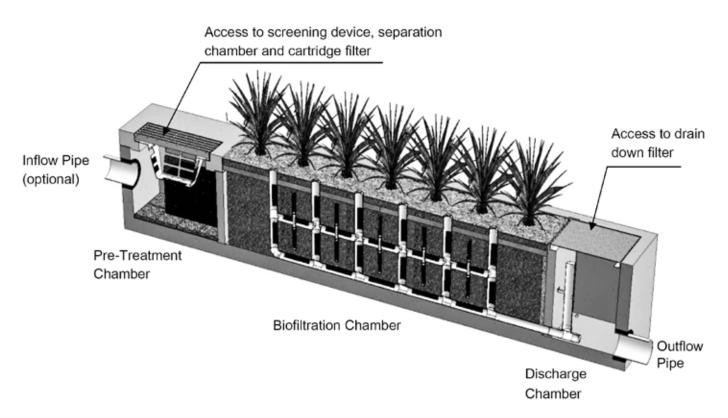

System Diagram

Maintenance Procedures

Screening Device

- 1. Remove grate or manhole cover to gain access to the screening device in the Pre- Treatment Chamber. Vault type units do not have screening device. Maintenance can be performed without entry.
- 2. Remove all pollutants collected by the screening device. Removal can be done manually or with the use of a vacuum truck.
- 3. Screening device can easily be removed from the Pre-Treatment Chamber to gain access to separation chamber and media filters below. Replace grate or manhole cover when completed.

Separation Chamber

- 1. Perform maintenance procedures of screening device listed above before maintaining the separation chamber.
- 2. With a pressure washer, spray down pollutants accumulated on walls and cartridge filters.
- 3. Vacuum out Separation Chamber and remove all accumulated pollutants. Replace screening device, grate or manhole cover when completed.

Cartridge Filters

- 1. Perform maintenance procedures on screening device and separation chamber before maintaining cartridge filters.
- 2. Enter separation chamber.
- 3. Unscrew the two bolts holding the lid on each cartridge filter and remove lid.
- 4. Remove each of 4 to 8 media cages holding the media in place.
- 5. Spray down the cartridge filter to remove any accumulated pollutants.
- 6. Vacuum out old media and accumulated pollutants.
- 7. Reinstall media cages and fill with new media from manufacturer or outside supplier. Manufacturer will provide specification of media and sources to purchase.
- 8. Replace the lid and tighten down bolts. Replace screening device, grate or manhole cover when completed.

Drain Down Filter

- 1. Remove hatch or manhole cover over discharge chamber and enter chamber. Entry into chambers may require confined space training based on state and local regulations.
- 2. Unlock and lift drain down filter housing and remove old media block. Replace with new media block. Lower drain down filter housing and lock into place.
- 3. Exit chamber and replace hatch or manhole cover.

Maintenance Notes

- 1. Following maintenance and/or inspection, it is recommended the maintenance operator prepare a maintenance/ inspection record. The record should include any maintenance activities performed, amount and description of debris collected, and condition of the system and its various filter mechanisms.
- 2. The owner should keep maintenance/inspection record(s) for a minimum of five years from the date of maintenance. These records should be made available to the governing municipality for inspection upon request at any time.
- 3. Transport all debris, trash, organics and sediments to approved facility for disposal in accordance with local and state requirements.
- 4. Entry into chambers may require confined space training based on state and local regulations.
- 5. No fertilizer shall be used in the Biofiltration Chamber.
- 6. Irrigation should be provided as recommended by manufacturer and/or landscape architect. Amount of irrigation required is dependent on plant species. Some plants may require irrigation.

Maintenance Procedure Illustration


Screening Device

The screening device is located directly under the manhole or grate over the Pre-Treatment Chamber. It's mounted directly underneath for easy access and cleaning. Device can be cleaned by hand or with a vacuum truck.



Separation Chamber

The separation chamber is located directly beneath the screening device. It can be quickly cleaned using a vacuum truck or by hand. A pressure washer is useful to assist in the cleaning process.

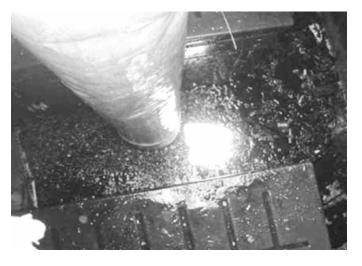

Cartridge Filters

The cartridge filters are located in the Pre-Treatment chamber connected to the wall adjacent to the biofiltration chamber. The cartridges have removable tops to access the individual media filters. Once the cartridge is open media can be easily removed and replaced by hand or a vacuum truck.



Drain Down Filter

The drain down filter is located in the Discharge Chamber. The drain filter unlocks from the wall mount and hinges up. Remove filter block and replace with new block.



Trim Vegetation

Vegetation should be maintained in the same manner as surrounding vegetation and trimmed as needed. No fertilizer shall be used on the plants. Irrigation per the recommendation of the manufacturer and or landscape architect. Different types of vegetation requires different amounts of irrigation.





Inspection Report Modular Wetlands Linear

Project Name	For Office Use Only											
Project Address	(Reviewed By)											
Owner / Management Company	(Reviewed by)											
Contact	(Date) Office personnel to con the left.											
Inspector Name	Time	AM / PM										
Type of Inspection Routine Follow Up Complaint Storm Storm Event in Last 72-hours? No Yes												
Weather Condition Additional Notes												
Inspection Checklist												
Modular Wetland System Type (Curb, Grate or UG Vault): Size (22', 14' or etc.):												
Structural Integrity:		Yes	Yes No Comments		nts							
Damage to pre-treatment access pressure?	cover (manh											
Damage to discharge chamber a pressure?	ccess cover ((manhole co	ver/grate) or (cannot be opened using normal lifting								
Does the MWS unit show signs of												
Is the inlet/outlet pipe or drain do	wn pipe dam	aged or othe	rwise not fun	ctioning properly?								
Working Condition:												
Is there evidence of illicit discharge or excessive oil, grease, or other automobile fluids entering and clogging the unit?												
Is there standing water in inappropriate areas after a dry period?												
Is the filter insert (if applicable) at	t capacity and	d/or is there	an accumulat	tion of debris/trash on the shelf system?								
Does the depth of sediment/trash specify which one in the commer	6			Depth:								
Does the cartridge filter media ne	ed replacem			Chamber:								
Any signs of improper functioning												
Other Inspection Items:												
Is there an accumulation of sedin	nent/trash/de	bris in the w	etland media	(if applicable)?								
Is it evident that the plants are ali												
Is there a septic or foul odor com	ing from insid	de the syster	n?									
Waste:	Yes	No		Recommended Maintena	intenance		Plant Information					
Sediment / Silt / Clay				No Cleaning Needed		<u> </u>	Damage to Plants					
Trash / Bags / Bottles				Schedule Maintenance as Planned		<u> </u>	Plant Replacement					
Green Waste / Leaves / Foliage				Needs Immediate Maintenance			Plant Trimming					
Additional Notes:												



Cleaning and Maintenance Report Modular Wetlands Linear

Project N	For	For Office Use Only						
Project A	(Pay	iewed By)						
Owner / I	Management Company				(city)	(Zip Code)		
Contact				Phone ()	_	(Dat Offi	ce personnel to complete section to the left.
Inspector Name				Date	/	_/	Time	AM / PM
Type of Inspection Routine Follow Up Complaint				☐ Storm		Storm Event in	Last 72-hours?	☐ No ☐ Yes
Weather Condition				Additional Notes				
						1	T	1
Site Map#	GPS Coordinates of Insert	Manufacturer / Description / Sizing	Trash Accumulation	Foliage Accumulation	Sediment Accumulation	Total Debris Accumulation	Condition of Med 25/50/75/100 (will be changed @ 75%)	Manufactures'
	Lat:	MWS						
	Long:	Catch Basins			_			
		MWS Sedimentation Basin						
		Media Filter Condition	•	•				
	Plant Condition Drain Down Media Condition							
		Discharge Chamber Condition						
		Drain Down Pipe Condition						
		Inlet and Outlet Pipe Condition						
Commer	ts:							



ENGINEERED SOLUTIONS

© 2022 CONTECH ENGINEERED SOLUTIONS LLC, A QUIKRETE COMPANY

800-338-1122

WWW.CONTECHES.COM

ALL RIGHTS RESERVED. PRINTED IN THE USA.

CONTECH ENGINEERED SOLUTIONS LLC PROVIDES SITE SOLUTIONS FOR THE CIVIL ENGINEERING INDUSTRY. CONTECH'S PORTFOLIO INCLUDES BRIDGES, DRAINAGE, SANITARY SEWER, STORMWATER AND EARTH STABILIZATION PRODUCTS. FOR INFORMATION ON OTHER CONTECH DIVISION OFFERINGS, VISIT CONTECHES.COM OR CALL 800-338-1122.

NOTHING IN THIS CATALOG SHOULD BE CONSTRUED AS A WARRANTY. APPLICATIONS SUGGESTED HEREIN ARE DESCRIBED ONLY TO HELP READERS MAKE THEIR OWN EVALUATIONS AND DECISIONS, AND ARE NEITHER GUARANTEES NOR WARRANTIES OF SUITABILITY FOR ANY APPLICATION. CONTECH MAKES NO WARRANTY WHATSOEVER, EXPRESS OR IMPLIED, RELATED TO HE APPLICATIONS, MATERIALS, COATINGS, OR PRODUCTS DISCUSSED HEREIN. ALL IMPLIED WARRANTIES OF MERCHANTABILITY AND ALL IMPLIED WARRANTIES OF FITNESS FOR ANY PARTICULAR PURPOSE ARE DISCLAIMED BY CONTECH. SEE CONTECH'S CONDITIONS OF SALE (AVAILABLE AT WWW.CONTECHES.COM/COS) FOR MORE INFORMATION.

SUPPORT

DRAWINGS AND SPECIFICATIONS ARE AVAILABLE AT WWW.CONTECHES.COM

Modular Wetlands Maintenance Guide 08/22



SECTION 7: SPECIAL REPORTS AND STUDIES

The following studies were conducted in preparation of this Report:

- Wetland Report, Wetland Resources, June, 2022
- Geotechnical Investigation, Cobalt Geosciences, June 2022

Job No.: C22-177